









Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 602		SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec		SHEET 1 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	PRIORITY	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>Cableway on Safety Grass</b>	<b>Wicksteed</b>	<b>M</b>	Generally satisfactory but the suspension chain sheath has broken away from the upper fixing bolt, the sheath is serviceable but recommend the redundant fixing is removed to prevent potential snagging hazard.					
		<b>M</b>	Monitor the safety grass surface level, recommend soil and seed is added where required to reduce undulation which may result in trip hazards.					
<b>2 x 5-A Side Goal on Grass</b>	<b>Wicksteed</b>	<b>L</b>	Generally satisfactory but monitor foundation integrity at one goal. Fixings fitted to upper rails at time of inspection to prevent potential finger entrapment hazards.					
<b>BMX Dirt Track on Grass</b>	<b>N/A</b>		The facility consists of an open area soil track, inspected to the requirements of BS EN 14974:2006 (relating to roller-sports equipment for the use of in-line skates, skateboards or similar roller sports equipment as well as BMX cycles), the standard refers mainly to manufactured structures and does not contain specific requirements for this type of facility, therefore, for the purposes of this inspection, direct clause references can not be quoted but observed hazards will be recorded					
		<b>MH</b>	Recommend the temporary jump ramp is removed to prevent potential fall and impact hazards The provision of a sign (pictogram) is recommended giving the following information: (a) facility for users of in-line skates, roller skates, skateboards and BMX cycles (b) use of appropriate protective equipment (e.g. helmet, knee pads, elbow pads) is recommended. (3) Administrator's identification (ref BS EN 14974:2008, clause 9)					
<b>Shelter on Concrete</b>	<b>Monster</b>	<b>L</b>	Generally satisfactory but recommend regular grounds maintenance at the approach to reduce potential slip and trip hazards.					
		<b>MH</b>	Broken glass around the shelter at time of inspection, groundsman advised.					
  <b>Wicksteed Leisure Ltd</b> <b>Digby St., Kettering</b> <b>Northants, NN16 8YJ</b> <b>Tel: 01536 517 028</b>		<b>Priority</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	<b>INDICATION OF RISK ASSESSMENT</b>		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>6.4.2011</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>£0.00</b>	



Certified Inspection Report for:		CONTACT :-		ORDER NO :-		SITE ADDRESS :-		SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		Sue Halkett Tel: 01327 341 057 E-mail:		602		Jubilee Field Bridge Street, Weedon Bec		2 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	PRIORITY	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Perforated Litter Bin	Wicksteed		Satisfactory condition					
2.75m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass	Wicksteed	M	Generally satisfactory but recommend excess links are removed to reduce potential snagging hazards ( <i>leave two links only through the 'key link' to effect security</i> )					
		M	Monitor vandalism damage at surface tiles, further deterioration may result in trip hazards.					
Pendulum Swing Basket Seat on Safety Grass	Wicksteed 2010		Satisfactory condition <i>Manufacturer recommends the universal joint / swing support bearing assembly should be replaced every 5 years, the assembly is 'sealed for life' unit and maintenance / repairs to the unit should not be attempted (ref BS EN1176-1:2008 clause 6.1.4.2), recommend</i>					
Double Zig-Zag Twister on Safety Grass	Wicksteed 2010	M	Satisfactory condition but recommend regular grounds maintenance at the area periphery to reduce potential trip hazards.					
Litter Bin			Satisfactory condition					
Leaning Post on Grass	SMP		Satisfactory condition					
Multi-sports Goal on Tarmac	SMP	M	Satisfactory condition but recommend regular grounds maintenance at the tarmac edging and within the goal mouth to combat erosion and reduce potential trip hazards.					
Multi-activity Unit on Grass	Playdale		Consisting of the following:					
Balance Chain		VL	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.					
 		Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	Priority	<b>INDICATION OF RISK ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>6.4.2011</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00 £0.00



Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 602		SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec		SHEET 3 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	PRIORITY	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>Suspended Walkway</b>			Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- <b>VL</b> Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn. <b>L</b> Monitor wear and condition of the suspended logs.					
<b>Balance Beam</b>			<b>M</b> Generally satisfactory but recommend long grass below the beam is cut regularly ( <i>long grass may conceal hazardous objects</i> )					
<b>Burma Chain Bridge</b>			Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- <b>VL</b> Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn. <b>L</b> Monitor the timber condition.					
<b>Toddler's Multi-play Unit on Grass</b>	<b>Playdale</b>		<b>M</b> Generally satisfactory but monitor the timber condition, recommend one damaged low level barrier backing board is removed or made safe to reduce potential splinter or snagging hazards ( <i>fire damage</i> ) <b>M</b> Recommend regular grounds maintenance below the bridge and within the slide tower to combat erosion and reduce potential slip and impact hazards.					
<b>9.4m Embankment Slide on Grass Mound, &amp; Tiles</b>	<b>Wicksteed</b>		<b>M</b> Generally satisfactory but recommend regular grounds maintenance at the side of the chute to combat erosion and reduce potential slip and impact hazards, in addition, recommend nettle growth is removed. <b>L</b> Monitor the gaps at tile joints where excessive gaps or lifting tiles may create trip hazards.					
<b>Inlaid Mound Access Steps</b>			Satisfactory condition					
<b>2 x Football Goal on Grass</b>	<b>Unknown</b>		<b>L</b> Satisfactory condition but recommend regular grounds maintenance to combat erosion and reduce potential slip & impact hazards.					
<b>2 x Park Bench on Concrete Base</b>			<b>M</b> Generally satisfactory but recommend support frames are painted & slats are treated to improve weather protection.					
 <b>Wicksteed Leisure Ltd</b> <b>Digby St., Kettering</b> <b>Northants, NN16 8YJ</b> <b>Tel: 01536 517 028</b>		<b>Priority</b> <b>INDICATION OF RISK ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- <b>C. Newell</b> DATE :- <b>6.4.2011</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>£0.00</b>			

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 602	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec		SHEET 4 of 4	
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	PRIORITY	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2 x Park Seat on Concrete Base		M	Generally satisfactory but recommend support frames are painted & slats are treated to improve weather protection.					
		M	Recommend missing top and front rails are replaced at one seat to prevent potential snagging hazards at projecting steel bar.					
Brick Encased Litter Bin			Satisfactory condition					
Dig Litter Bin			Satisfactory condition					
General		MH	Unrestricted access to open water source, parental supervision recommended at all times.					
		M	Unrestricted access to car parking area, parental supervision recommended at all times.					
		M	Access by dogs is not physically prohibited recommend your routine inspection includes monitoring for and removal of animal faeces. <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i>					
			The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			<i>A wide range of signs are available, visit <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a> or contact <a href="mailto:sales@wicksteed.co.uk">sales@wicksteed.co.uk</a> for more information</i>		
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.com">www.wicksteed.com</a>		Priority	HIGH & MEDIUM HIGH RISK - See Introductory Notes	INSPECTED BY :- <b>C. Newell</b>	PARTS SUB TOTAL		<b>£0.00</b>	
		H/MH	MEDIUM RISK - See Introductory Notes	DATE :- <b>6.4.2011</b>	BALANCE C / FORWARD		<b>£0.00</b>	
		M	VERY LOW & LOW RISK - See Introductory Notes		PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)		<b>£0.00</b>	
		VL/L			ESTIMATE TO FIT PARTS * Based on all works ordered		<b>£0.00</b>	
					TOTAL COST OF WORKS, EXC VAT		<b>£0.00</b>	

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 602		SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec		SHEET 1 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	PRIORITY	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>Crazy Twister on Safety Grass</b>	<b>Wicksteed 2010</b>		Satisfactory condition ( <i>ensure that regular greasing of bearings is included within your annual maintenance schedule.</i> )					
<b>Trim Trail on Grass</b>	<b>Playdale</b>		The individual components are installed as a cluster unit (ref BS EN 1176 -1:2008, clause 4.2.8.3; note 1 and definition 3.19) and consists of the following:-					
<b>Burma Chain Bridge</b>		L	Generally satisfactory but monitor the timber condition, initial stages of wood rot evident within brace logs but structural integrity is not affected at present.					
<b>Step Post Cluster</b>		L	Generally satisfactory but monitor the timber condition and foundation integrity					
<b>Triple Balance Beam</b>		L	Generally satisfactory but monitor the timber condition and foundation integrity					
		M	Recommend redundant chain fixing is removed to reduce potential snagging and collision hazard, ensure redundant fixing hole is sealed when fixing has been removed, to prevent finger entrapment hazard.					
<b>2 x Talking Flower on Grass</b>	<b>Wicksteed 2010</b>	L	Satisfactory condition but recommend regular grounds maintenance to combat erosion and reduce potential slip hazards.					
<b>Mystical World Multi-play Unit on Safety Grass</b>	<b>Wicksteed 2010</b>		Satisfactory condition					
<b>2.3m 1 Bay 2 Seat Swing on Safety Grass</b>	<b>Wicksteed 2010</b>		Satisfactory condition					
<b>Spirowhirl Roundabout on Wet Pour</b>	<b>Wicksteed 2010</b>	M	Satisfactory condition ( <i>ensure that regular greasing of bearings is included within your annual maintenance schedule.</i> ) Recommend soil and seed is added at the surface edging to reduce potential trip hazards					
 <b>Wicksteed Leisure Ltd</b> <b>Digby St., Kettering</b> <b>Northants, NN16 8YJ</b> <b>Tel: 01536 517 028</b>		<b>Priority</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	<b>INDICATION OF RISK ASSESSMENT</b>		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>6.4.2011</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£0.00</b> <b>£0.00</b> <b>£0.00</b>	<b>See sheet 4</b>

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 602	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec			SHEET 2 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	PRIORITY	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>1.75m 1 Bay 2 Seat Swing 2 x Cradle Seat on Tiles</b>	<b>Wicksteed</b>	<b>MH</b>	Generally satisfactory but shackles and bushes are worn or missing, recommend these are replaced as soon as possible ( <i>note: wear within the swing support bearing may affect seating of new bushes and excess wear could result in structural failure</i> )	4	4064.007	Shackle, pin & sellok pin	£4.00	<b>£16.00</b>
					4	2511.010	CT10 Oilite Bush	£1.05
		<b>M</b>	Monitor wear at the chain links, recommend one set of chains is replaced within 12 months.	1	4061.211	6' chains to suit cradle seat	£30.00	<b>£30.00</b>
		<b>M</b>	Recommend excess chain links are removed to reduce potential snagging hazards ( <i>leave two links only through the 'key link' to effect security</i> )					
		<b>M</b>	Recommend one damaged tile is replaced to reduce potential trip hazard.	1	6130.151	1m x 1m x 40mm black tile	£51.00	<b>£51.00</b>
		<b>M</b>	Recommend soil and seed is added at the timber edging to reduce potential trip hazards, in addition, monitor damage at the edging.	1	1811.012	Tile Adhesive	£8.00	<b>£8.00</b>
						<b>Labour cost to fit parts &amp; replace tile*</b>	<b>£120.00</b>	
<b>3.4m Pedestal Slide on Tiles</b>	<b>Wicksteed</b>		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-					
		<b>L</b>	Fails Head & Torso probe test at the hand and guardrails (ref BS EN 1176-1:2008, clause 4.2.7.2), no action recommended at present.					
		<b>L</b>	Fails Toggle test at chute entrance (BS EN 1176-1:2008, clause 4.2.7.3, no action recommended at present					
		<b>L</b>	Fails Stair criteria (BS EN 1176-1:2008: clause 4.2.9.2), no action recommended at present					
		<b>M</b>	Recommend soil and seed is added at the surface edging to reduce potential trip hazards					
<b>Spring Platform on Grass</b>	<b>Miracle</b>		Satisfactory condition					
<b>Speed Bike Spring Mobile on Grass</b>	<b>Ledon</b>		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-					
		<b>L</b>	Fails foot rest requirements for spring mobiles (ref BS EN 1176-6: 2008 clause 4.6), no action recommended at present.					
		<b>M</b>	Recommend regular grounds maintenance to combat erosion and reduce potential slip and impact hazards.					
 <b>Wicksteed Leisure Ltd</b> Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		<b>Priority</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	<b>INDICATION OF RISK ASSESSMENT</b>		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>6.4.2011</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£109.20</b> <b>£0.00</b> <b>£109.20</b> See sheet 4	

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 602		SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec		SHEET 3 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	PRIORITY	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Link Non Bump See Saw on Safety Grass	Wicksteed 2010	VL	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- 230mm minimum ground clearance recommended below the seats at the lowest point of travel (ref BS EN 1176-6:2008, clause 4.9), (220mm one end, due to surface levels), no action recommended at present.					
4 Way Spring Mobile on Safety Grass	Miracle	M	Generally satisfactory but recommend one missing tube plug is replaced to prevent insertion of fingers or foreign objects.	1	2611-007	Plastic Plug To Suit 20 NBT <b>Labour cost to fit plug*</b>	£0.72 <b>£5.00</b>	<b>£0.72</b>
Climbing Frame on Safety Grass	Miracle		Satisfactory condition					
Windsor Picnic Table	Wicksteed	VL	Generally satisfactory but monitor ground fixing integrity					
Litter Bin		L	Recommend timber slats are rubbed down and treated to maintain weather protection.					
Fence			Satisfactory condition					
2 x Single Gate		M	Generally satisfactory but recommend regular grounds maintenance at the entrance points to combat erosion and reduce potential slip hazards.					
		M	Monitor gate closing rate (note: fast return rate may result in collision or impact hazards), recommend spring tension is adjusted to reduce closing rate as required.					
Vehicle Access Gate			Satisfactory condition (locked at time of inspection)					
Dog Litter Bin (outside area)			Satisfactory condition					
General		M	Monitor concrete approach footpath from Croft Way, further deterioration may result in trip hazards, recommend footpath repair or upgrade as soon as resources permit					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		<b>Priority</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	<b>INDICATION OF RISK ASSESSMENT</b>		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>6.4.2011</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£0.72</b> <b>£109.20</b> <b>£109.92</b> See sheet 4	

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 602	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec		SHEET 4 of 4	
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	PRIORITY	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
			The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			<i>A wide range of signs are available, visit <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a> or contact <a href="mailto:sales@wicksteed.co.uk">sales@wicksteed.co.uk</a> for more information</i>		
			<b>Wicksteed Leisure Ltd</b> <b>Digby St., Kettering</b> <b>Northants, NN16 8YJ</b> <b>Tel: 01536 517 028</b> <a href="http://www.wicksteed.com">www.wicksteed.com</a>	<b>Priority</b> H/MH M VL/L	HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- <b>C. Newell</b> DATE :- <b>6.4.2011</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	<b>£0.00</b> <b>£109.20</b> <b>£109.20</b> <b>£125.00</b> <b>£234.20</b>