




Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:	ORDER NO :- 408	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN			SHEET 1 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Cableway on Safety Grass	Wicksteed	M	Generally satisfactory but the suspension chain sheath has been removed and flexible chain creates potential strangulation hazard recommend the suspension chain & seat assembly are replaced	1	5082.237	Pendulum seat & chain assembly Labour cost to fit parts*	£119.00 see sheet 3	£119.00
2 x 5-A Side Goal on Grass	Wicksteed	M	Monitor the safety grass surface level, recommend soil and seed is added where required to reduce undulation which may result in trip hazards, in addition, recommend regular grounds maintenance around the ramp and platform to combat erosion & reduce potential slip and impact hazards. Satisfactory condition					
BMX Dirt Track on Grass	N/A		The facility consists of an open area soil track, inspected to the requirements of BS EN 14974:2006 (relating to roller-sports equipment for the use of in-line skates, skateboards or similar roller sports equipment as well as BMX cycles), the standard refers mainly to manufactured structures and does not contain specific requirements for this type of facility, therefore, for the purposes of this inspection, direct clause references can not be quoted but observed hazards will be recorded The provision of a sign (pictogram) is recommended giving the following information: (a) facility for users of in-line skates, roller skates, skateboards and BMX cycles (b) use of appropriate protective equipment (e.g. helmet, knee pads, elbow pads) is recommended. (3) Administrator's identification (ref BS EN 14974:2008, clause 9)					
Shelter on Concrete	Monster	L M	Generally satisfactory but recommend regular grounds maintenance at the approach to reduce potential slip and trip hazards. Litter hazard around the area at time of inspection advised.					
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 14.3.2012	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£119.00 £0.00 £119.00 See sheet 4	



Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL	CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:	ORDER NO :- 408	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	SHEET 2 of 4
--	---	---------------------------	---	---


DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Perforated Litter Bin	Wicksteed		Satisfactory condition					
2.75m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass	Wicksteed	M	Generally satisfactory but recommend excess links are removed to reduce potential snagging hazards (<i>leave two links only through the 'key link' to effect security</i>)					
Pendulum Swing Basket Seat on Safety Grass	Wicksteed 2010		Satisfactory condition <i>Manufacturer recommends the universal joint / swing support bearing assembly should be replaced every 5 years, the assembly is 'sealed for life' unit and maintenance / repairs to the unit should not be attempted (ref BS EN1176-1:2008 clause 6.1.4.2), recommend</i>					
Double Zigzag Twister on Safety Grass	Wicksteed 2010	M	Satisfactory condition but recommend regular grounds maintenance at the area periphery to reduce potential trip hazards.					
Litter Bin			Satisfactory condition					
Leaning Post on Grass	SMP		Satisfactory condition					
Multi-sports Goal on Tarmac	SMP	M	Satisfactory condition but recommend regular grounds maintenance at the tarmac edging and within the goal mouth to combat erosion and reduce potential trip hazards.					
Multi-activity Unit on Grass	Playdale		Consisting of the following:					
Balance Chain		VL	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.					

 <small>Register of Play Inspectors International</small> 	Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	INDICATION OF RISK RATING ASSESSMENT			INSPECTED BY :- C. Newell	PARTS SUB TOTAL	£0.00
	H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes	DATE :-		BALANCE C / FORWARD	£119.00	
	M	MEDIUM RISK - See Introductory Notes	14.3.2012		PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)	£119.00	
	VL/L	VERY LOW & LOW RISK - See Introductory Notes			ESTIMATE TO FIT PARTS * Based on all works ordered	See sheet 4	

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL	CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:	ORDER NO :- 408	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	SHEET 3 of 4
--	---	---------------------------	---	---


DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Suspended Walkway		VL	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.					
		L	Monitor wear and condition of the suspended logs.					
Balance Beam			Satisfactory condition					
Burma Chain Bridge		VL	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.					
		L	Monitor the timber condition.					
		M	Recommend regular grounds maintenance around the unit to combat erosion and reduce potential slip, trip and impact hazards, especially at excavation points.					
Toddler's Multi-play Unit on Grass	Playdale	M	Generally satisfactory but monitor the timber condition, recommend one damaged low level barrier backing board is removed or made safe to reduce potential splinter or snagging hazards (<i>fire damage</i>)					
		M	Recommend regular grounds maintenance below the bridge and within the slide tower to combat erosion and reduce potential slip and impact hazards.					
Concrete Litter Bin	Unknown		Satisfactory condition					
2 x Log Stool	Unknown		Satisfactory condition (<i>was bench but seat slat has been removed</i>)					
9.4m Embankment Slide on Grass Mound & Tiles with Inlaid Mound Access Steps	Wicksteed	M	Generally satisfactory but recommend regular grounds maintenance at the side of the chute to combat erosion and reduce potential slip and impact hazards, in addition, recommend nettle growth is removed.					
		L	Recommend loose fixings at start section support tubes are secured to improve structural integrity and unit stability			Labour cost to secure loose fixings* & fit seat and chain on sheet 1	£100.00	
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles may create trip hazards.					

 <small>Register of Play Inspectors International</small> 	Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	INDICATION OF RISK RATING ASSESSMENT			INSPECTED BY :- C. Newell	PARTS SUB TOTAL	£0.00
	H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes			DATE :-	BALANCE C / FORWARD	£119.00
	M	MEDIUM RISK - See Introductory Notes			14.3.2012	PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)	£119.00
	VL/L	VERY LOW & LOW RISK - See Introductory Notes				ESTIMATE TO FIT PARTS * Based on all works ordered	£100.00

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 408		SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN		SHEET 4 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
2 x Football Goal on Grass	Unknown	L	Satisfactory condition but recommend regular grounds maintenance to combat erosion and reduce potential slip & impact hazards.						
2 x Park Bench on Concrete Base		M	Generally satisfactory but recommend support frames are painted & slats are treated to improve weather protection.						
2 x Park Seat on Concrete Base		M	Generally satisfactory but recommend support frames are painted & slats are treated to improve weather protection.						
		M	Recommend missing top and front rails are replaced at one seat to prevent potential snagging hazards at projecting steel bar.						
Brick Encased Litter Bin				Generally satisfactory but monitor weather damaged at bricks & mortar					
Dig Litter Bin				Satisfactory condition					
General		MH	Unrestricted access to open water source, parental supervision recommended at all times.						
	M	Unrestricted access to car parking area, parental supervision recommended at all times.							
	M	Access by dogs is not physically prohibited recommend your routine inspection includes monitoring for and removal of animal faeces. <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i>							
			The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			<i>A wide range of signs are available, visit www.wicksteed.co.uk or contact sales@wicksteed.co.uk for more information</i>			
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 14.3.2012	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	£0.00 £119.00 £119.00 £100.00 £219.00		

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:	ORDER NO :- 408	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW	SHEET 1 of 4
---	--	---	---------------------------	---	------------------------------

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Crazy Twister on Safety Grass	Wicksteed 2010		Satisfactory condition <i>(ensure that regular greasing of bearings is included within your annual maintenance schedule.)</i>					
Trim Trail on Grass	Playdale		The individual components are installed as a cluster unit (ref BS EN 1176 -1:2008, clause 4.2.8.3; note 1 and definition 3.19) and consists of the following:-			<i>(these units are approaching end of service, recommend budgetary provision for removal or replacement within 12 ~ 24 months)</i>		
Burma Chain Bridge		L	Generally satisfactory but monitor the timber condition, initial stages of wood rot evident within brace logs but structural integrity is not affected at present.					
Step Post Cluster		L	Generally satisfactory but monitor the timber condition and foundation integrity					
Triple Balance Beam		L	Generally satisfactory but monitor the timber condition and foundation integrity					
		M	Recommend redundant chain fixing is removed to reduce potential snagging and collision hazard, ensure redundant fixing hole is sealed when fixing has been removed, to prevent finger entrapment hazard.					
2 x Talking Flower on Grass	Wicksteed 2010		Satisfactory condition					
Mystical World Multi-play Unit on Safety Grass	Wicksteed 2010		Satisfactory condition					
2.3m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass	Wicksteed 2010	L	Generally satisfactory but monitor vandalism damage at seat edges, further damage could expose leading metal edges & create potential impact hazards.					
Spirowhirl Roundabout on Wet Pour	Wicksteed 2010		Satisfactory condition <i>(ensure that regular greasing of bearings is included within your annual maintenance schedule.)</i>					
		M	Recommend soil and seed is added at the surface edging to reduce potential trip hazards					

 <p>Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028</p>	INDICATION OF RISK RATING ASSESSMENT			INSPECTED BY :-	PARTS SUB TOTAL	£0.00
	H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes		C. Newell	BALANCE C / FORWARD	£0.00
	M	MEDIUM RISK - See Introductory Notes		DATE :-	PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)	£0.00
	VL/L	VERY LOW & LOW RISK - See Introductory Notes		14.3.2012	ESTIMATE TO FIT PARTS * Based on all works ordered	See sheet 4


Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 408		SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW		SHEET 2 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
1.75m 1 Bay 2 Seat Swing 2 x Cradle Seat on Tiles	Wicksteed	H	Shackles and bushes are worn or missing, extensive wear at the swing support bearings, further deterioration is likely to result in shackle pin failure under load, no remedial action possible with the existing parts, recommend the top bar is replaced as soon as possible, in addition advise seats and suspensions are removed to prevent use pending repair.	1	5081-002	1B2S Top Bar Assy (3075mm long) *RED*	£316.00	£316.00	
				4	4064.007	Shackle, pin & sellok pin	£4.00	£16.00	
				1	4061.211	6' chains to suit cradle seat	£30.00	£30.00	
				2	5084-002	End head casting** (the end head castings have been quoted as a precaution and will only be used if the existing ones need replacing - if they are not used the cost will be credited from the invoice)	£123.00	£246.00	
				M	One set chains wearing, recommend these are replaced with the installation of new top bar assembly.				
3.4m Pedestal Slide on Tiles	Wicksteed	M	Recommend one damaged tile is replaced to reduce potential trip hazard.	1	6130.151	1m x 1m x 40mm black tile	£51.00	£51.00	
		M	Recommend soil and seed is added at the timber edging to reduce potential trip hazards, in addition, monitor damage at the edging.	1	1811.012	Tile Adhesive	£8.00	£8.00	
							Labour cost to fit parts & replace tile* & fit plug on sheet 3	£240.00	
Spring Platform on Grass	Miracle		Satisfactory condition						
Speed Bike Spring Mobile on Grass	Ledon		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- L Fails Head & Torso probe test at the hand and guardrails (ref BS EN 1176-1:2008, clause 4.2.7.2), no action recommended at present. L Fails Toggle test at chute entrance (BS EN 1176-1:2008, clause 4.2.7.3, no action recommended at present L Fails Stair criteria (BS EN 1176-1:2008: clause 4.2.9.2), no action recommended at present M Recommend soil and seed is added at the surface edging to reduce potential trip hazards						
		L	Fails foot rest requirements for spring mobiles (ref BS EN 1176-6: 2008 clause 4.6), no action recommended at present.						
		M	Recommend regular grounds maintenance to combat erosion and reduce potential slip and impact hazards.						



Wicksteed Leisure Ltd
Digby St., Kettering
Northants, NN16 8YJ
Tel: 01536 517 028


INDICATION OF RISK RATING ASSESSMENT	
H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes
M	MEDIUM RISK - See Introductory Notes
VL/L	VERY LOW & LOW RISK - See Introductory Notes

INSPECTED BY :- C. Newell	PARTS SUB TOTAL	£667.00
DATE :- 14.3.2012	BALANCE C / FORWARD	£0.00
	PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)	£667.00
	ESTIMATE TO FIT PARTS * Based on all works ordered	See sheet 4

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 408		SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW		SHEET 3 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Link Non Bump See Saw on Safety Grass	Wicksteed 2010	VL	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- 230mm minimum ground clearance recommended below the seats at the lowest point of travel (ref BS EN 1176-6:2008, clause 4.9), (220mm one end, due to surface levels), no action recommended at present.						
4 Way Spring Mobile on Safety Grass	Miracle	M	Generally satisfactory but recommend the missing tube plugs are replaced to prevent insertion of fingers or foreign objects.	2	2611-007	Plastic Plug To Suit 20 NBT	£0.72	£1.44	
Climbing Frame on Safety Grass	Miracle		Satisfactory condition						
Windsor Picnic Table	Wicksteed	VL	Generally satisfactory but monitor ground fixing integrity						
3 x Timber Bench (2 outside area)		L	Recommend timber slats are rubbed down and treated to maintain weather protection.						
Litter Bin			Satisfactory condition						
Fence			Satisfactory condition						
2 x Single Gate		M	Generally satisfactory but recommend regular grounds maintenance at the entrance points to combat erosion and reduce potential slip hazards.						
		M	Monitor gate closing rate (note: fast return rate may result in collision or impact hazards), recommend spring tension is adjusted to reduce closing rate as required.						
Vehicle Access Gate			Satisfactory condition (locked at time of inspection)						
Dog Litter Bin (outside area)			Satisfactory condition						
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 14.3.2012		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£1.44 £667.00 £668.44 See sheet 4

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:	ORDER NO :- 408	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW	SHEET 4 of 4
--	--	---	-------------------------------	---	---

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
General		M	<p>Monitor concrete approach footpath from Croft Way, further deterioration may result in trip hazards, recommend footpath repair or upgrade as soon as resources permit</p> <p>The provision of a sign (pictogram) is recommended giving the following information:</p> <p>a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)</p>			<p><i>A wide range of signs are available, visit www.wicksteed.co.uk or contact sales@wicksteed.co.uk for more information</i></p>		

 <p>Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028</p> <p>www.wicksteed.co.uk</p>	INDICATION OF RISK RATING ASSESSMENT			INSPECTED BY :- C. Newell DATE :- 14.3.2012	PARTS SUB TOTAL	£0.00
	H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes	BALANCE C / FORWARD	£667.00			
	M MEDIUM RISK - See Introductory Notes	PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)	£667.00			
	VL/L VERY LOW & LOW RISK - See Introductory Notes	ESTIMATE TO FIT PARTS * Based on all works ordered	£240.00			
		TOTAL COST OF WORKS, EXC VAT	£907.00			