




Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:	ORDER NO :- 436	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN			SHEET 1 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>Cableway on Safety Grass</b>	<b>Wicksteed</b>	<b>MH</b>	Generally satisfactory but extensive damage to the seat creates potential impact hazards, recommend the seat is replaced as soon as possible	<b>1</b>	2903-017	Button Seat <b>Labour cost to fit parts*</b>	£42.00 <b>£60.00</b>	<b>£42.00</b>
<b>2 x 5-A Side Goal on Grass</b>	<b>Wicksteed</b>	<b>L</b>	Recommend regular grounds maintenance at grass surface adjacent to start ramp to combat erosion and reduce potential slip hazards.					
<b>BMX Dirt Track on Grass</b>	<b>Natural Play</b>	<b>L</b>	Generally satisfactory but recommend regular grounds maintenance at the riding surface					
<b>Dirt Track Signage</b>			Satisfactory condition					
<b>Shelter on Concrete</b>	<b>Monster</b>	<b>L</b>	Generally satisfactory but recommend regular grounds maintenance at the approach to reduce potential slip and trip hazards.					
<b>Perforated Litter Bin on Grass</b>	<b>Wicksteed</b>		Satisfactory condition					
<b>2.75m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass</b>	<b>Wicksteed</b>	<b>M</b>	Generally satisfactory but recommend excess links are removed to reduce potential snagging hazards ( <i>leave two links only through the 'key link' to effect security</i> )					
		<b>L</b>	Monitor vandalism at sides of the seats, further damage could expose integral metal parts and result in impact hazards, especially at leading edges.					
<b>Pendulum Swing Basket Seat on Safety Grass</b>	<b>Wicksteed 2010</b>		Satisfactory condition <i>Manufacturer recommends the universal joint / swing support bearing assembly should be replaced every 5 years, the assembly is 'sealed for life' unit and maintenance / repairs to the unit should not be attempted (ref BS EN1176-1:2008 clause 6.1.4.2), recommend</i>					
 <b>Wicksteed Leisure Ltd</b> <b>Digby St., Kettering</b> <b>Northants, NN16 8YJ</b> <b>Tel: 01536 517 028</b>			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>4.4.2013</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£42.00</b> <b>£0.00</b> <b>£42.00</b> <b>See sheet 4</b>	


<b>Certified Inspection Report for:</b> <b>Weedon Bec Parish Council</b> 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		<b>CONTACT :-</b> Sue Halkett <b>Tel:</b> 01327 341 057 <b>E-mail:</b>	<b>ORDER NO :-</b> 436	<b>SITE ADDRESS :-</b> Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	<b>SHEET</b> <b>2</b> <b>of</b> <b>4</b>
--	--	---	---------------------------	---	---

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>Double Zigzag Twister on Safety Grass</b>	<b>Wicksteed 2010</b>	<b>L</b>	Satisfactory condition but monitor wear at the bearings <i>(Ensure that the regular greasing of the bearings is included within your annual maintenance schedule.)</i>					
<b>Litter Bin on Grass</b>			Satisfactory condition					
<b>Leaning Post on Grass</b>	<b>SMP</b>		Satisfactory condition					
<b>Multi-sports Goal on Tarmac</b>	<b>SMP</b>	<b>M</b>	Satisfactory condition but recommend regular grounds maintenance at the tarmac edging and within the goal mouth to combat erosion and reduce potential trip hazards.					
<b>Multi-activity Unit on Grass</b>	<b>Playdale</b>		Consisting of the following:					
<b>Balance Chain</b>		<b>VL</b>	Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.					
<b>Suspended Walkway</b>		<b>VL</b>	Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.					
<b>Balance Beam</b>		<b>L</b>	Monitor wear and condition of the suspended logs. Satisfactory condition					
<b>Burma Chain Bridge</b>		<b>VL</b>	Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.					
		<b>L</b>	Monitor timber condition, climatic conditions are likely to affect the timber appearance (air splits etc), these would not normally affect structural integrity but loose material should be removed or made safe to reduce potential splinter or abrasion hazards <i>(do not fill splits as this can lead to further damage during the natural expansion and contraction process)</i>					
		<b>L</b>	Recommend regular grounds maintenance around the unit to combat erosion and reduce potential slip hazards					

 <small>Register of Play Inspectors International</small> 	<b>Wicksteed Leisure Ltd</b> <b>Digby St., Kettering</b> <b>Northants, NN16 8YJ</b> <b>Tel: 01536 517 028</b>	<b>INDICATION OF RISK RATING ASSESSMENT</b>			<b>INSPECTED BY :-</b> <b>C. Newell</b>	<b>PARTS SUB TOTAL</b>	<b>£0.00</b>
	H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes			<b>DATE :-</b> <b>4.4.2013</b>	<b>BALANCE C / FORWARD</b>	<b>£42.00</b>
	M	MEDIUM RISK - See Introductory Notes				<b>PARTS TOTAL EXC. CARRIAGE &amp; VAT. (E&amp;O.E.)</b>	<b>£42.00</b>
	VL/L	VERY LOW & LOW RISK - See Introductory Notes				<b>ESTIMATE TO FIT PARTS * Based on all works ordered</b>	<b>See sheet 4</b>

<b>Certified Inspection Report for:</b> <b>Weedon Bec Parish Council</b> 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL	<b>CONTACT :-</b> Sue Halkett Tel: 01327 341 057 E-mail:	<b>ORDER NO :-</b> 436	<b>SITE ADDRESS :-</b> Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	<b>SHEET</b> <b>3</b> <b>of</b> <b>4</b>
--	---	---------------------------	---	---


DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>Toddler's Multi-play Unit on Grass</b>	<b>Playdale</b>	<b>M</b>	Generally satisfactory but monitor the timber condition, recommend one damaged low level barrier backing board is removed or made safe to reduce potential splinter or snagging hazards ( <i>fire damage</i> )					
		<b>M</b>	Recommend regular grounds maintenance below the bridge and within the slide tower to combat erosion and reduce potential slip and impact hazards.					
<b>Concrete Litter Bin on Grass</b>	<b>Unknown</b>		Satisfactory condition					
<b>2 x Log Stool on Grass</b>	<b>Unknown</b>		Satisfactory condition ( <i>was bench but seat slat has been removed</i> )					
<b>9.4m Embankment Slide on Grass Mound &amp; Tiles with Inlaid Mound Access Steps</b>	<b>Wicksteed</b>	<b>M</b>	Generally satisfactory but recommend regular grounds maintenance at the side of the chute to combat erosion and reduce potential slip and impact hazards, in addition, recommend nettle growth is removed.					
		<b>L</b>	Monitor the gaps at tile joints where excessive gaps or lifting tiles may create trip hazards.					
<b>2 x Football Goal on Grass</b>	<b>Unknown</b>	<b>L</b>	Satisfactory condition but recommend regular grounds maintenance to combat erosion and reduce potential slip & impact hazards.					
<b>2 x Park Bench on Concrete Base &amp; Grass</b>		<b>M</b>	Generally satisfactory but recommend support frames are painted & slats are treated to improve weather protection.					
<b>2 x Park Seat on Concrete Base &amp; Grass</b>		<b>M</b>	Generally satisfactory but recommend support frames are painted & slats are treated to improve weather protection.					
		<b>M</b>	Recommend missing top and front rails are replaced at one seat to prevent potential snagging hazards at projecting steel bar.					
<b>Brick Encased Litter Bin on Grass</b>			Generally satisfactory but monitor weather damaged at bricks & mortar					
<b>Dig Litter Bin Post Mounted</b>			Satisfactory condition					


	<b>Wicksteed Leisure Ltd</b>	<b>INDICATION OF RISK RATING ASSESSMENT</b>			INSPECTED BY :-	PARTS SUB TOTAL	<b>£0.00</b>
	<b>Digby St., Kettering</b>	H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes		<b>C. Newell</b>	BALANCE C / FORWARD	<b>£42.00</b>
	<b>Northants, NN16 8YJ</b>	M	MEDIUM RISK - See Introductory Notes		DATE :-	PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)	<b>£42.00</b>
	<b>Tel: 01536 517 028</b>	VL/L	VERY LOW & LOW RISK - See Introductory Notes		<b>4.4.2013</b>	ESTIMATE TO FIT PARTS * Based on all works ordered	<b>See sheet 4</b>


<b>Certified Inspection Report for:</b> <b>Weedon Bec Parish Council</b> 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		<b>CONTACT :-</b> Sue Halkett <b>Tel:</b> 01327 341 057 <b>E-mail:</b>	<b>ORDER NO :-</b> 436	<b>SITE ADDRESS :-</b> Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	<b>SHEET</b> <b>4</b> <b>of</b> <b>4</b>
--	--	---	---------------------------	---	---


DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>General</b>		<b>MH</b>	Unrestricted access to open water source, parental supervision recommended at all times.					
		<b>M</b>	Unrestricted access to car parking area, parental supervision recommended at all times.					
			The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			<i>A wide range of signs are available, visit <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a> or contact <a href="mailto:sales@wicksteed.co.uk">sales@wicksteed.co.uk</a> for more information</i>		
		<b>M</b>	Access by dogs is not physically prohibited recommend your routine inspection includes monitoring for and removal of animal faeces. <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i>					



 <b>Wicksteed Leisure Ltd</b> <b>Digby St., Kettering</b> <b>Northants, NN16 8YJ</b> <b>Tel: 01536 517 028</b> <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>	<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :-	PARTS SUB TOTAL	<b>£0.00</b>
		<b>C. Newell</b> DATE :- <b>4.4.2013</b>	BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	<b>£42.00</b> <b>£42.00</b> <b>£60.00</b> <b>£102.00</b>

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 436	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW		SHEET 1 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>Crazy Twister on Safety Grass</b>	<b>Wicksteed 2010</b>		Satisfactory condition <i>(ensure that regular greasing of bearings is included within your annual maintenance schedule.)</i>					
<b>Trim Trail on Grass</b>	<b>Playdale</b>		The individual components are installed as a cluster unit (ref BS EN 1176 -1:2008, clause 4.2.8.3; note 1 and definition 3.19) and consists of the following:-			<i>(these units are approaching end of service, recommend budgetary provision for removal or replacement within 12 months)</i>		
<b>Burma Chain Bridge</b>		<b>L</b>	Generally satisfactory but monitor the timber condition, initial stages of wood rot evident within brace & support logs, structural integrity does not appear to be affected at present.					
<b>Step Post Cluster</b>		<b>L</b>	Generally satisfactory but monitor the timber condition and foundation integrity					
<b>Triple Balance Beam</b>		<b>M</b>	Generally satisfactory but monitor the timber condition, wood rot evident within the centre beam and further deterioration could result in splinter hazards, in addition, monitor the foundation integrity					
		<b>M</b>	Recommend redundant chain fixing is removed to reduce potential snagging and collision hazard, ensure redundant fixing hole is sealed when fixing has been removed, to prevent finger entrapment hazard.					
<b>2 x Talking Flower on Grass</b>	<b>Wicksteed 2010</b>		Satisfactory condition					
<b>Mystical World Multi-play Unit on Safety Grass</b>	<b>Wicksteed 2010</b>		Satisfactory condition					
<b>2.3m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass</b>	<b>Wicksteed 2010</b>	<b>L</b>	Generally satisfactory but monitor vandalism damage at seat edges, further damage could expose leading metal edges & create potential impact hazards.					
 <b>Wicksteed Leisure Ltd</b> <b>Digby St., Kettering</b> <b>Northants, NN16 8YJ</b> <b>Tel: 01536 517 028</b>			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>4.4.2013</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>See sheet 4</b>	

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 436		SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW		SHEET 2 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
<b>Spirowhirl Roundabout on Wet Pour</b>	<b>Wicksteed 2010</b>	<b>M</b>	Satisfactory condition ( <i>ensure that regular greasing of bearings is included within your annual maintenance schedule.</i> ) Recommend soil and seed is added at the surface edging to reduce potential trip hazards						
<b>1.75m 1 Bay 2 Seat Swing 2 x Cradle Seat on Tiles</b>	<b>Wicksteed</b>	<b>M</b>	Generally satisfactory but recommend soil and seed is added at the timber edging to reduce potential trip hazards, in addition, monitor damage at the edging.						
<b>3.4m Pedestal Slide on Tiles</b>	<b>Wicksteed</b>	<b>L</b>	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- Fails Head & Torso probe test at the hand and guardrails (ref BS EN 1176-1:2008, clause 4.2.7.2), no action recommended at present.						
		<b>L</b>	Fails Toggle test at chute entrance (BS EN 1176-1:2008, clause 4.2.7.3, no action recommended at present						
		<b>L</b>	Fails Stair criteria (BS EN 1176-1:2008: clause 4.2.9.2), no action recommended at present						
		<b>M</b>	Recommend the painting of this unit is included within your current maintenance schedule ( <i>note: ensure surface coatings are free of harmful contents to avoid potential toxic hazards, ref BS EN 1176-1:2008, clause 4.1.1</i> )	<b>2</b>	2820-002	Primer Per Litre	£19.00	<b>£38.00</b>	
				<b>1</b>	2820-004	Red Gloss Paint Per Litre	£19.00	<b>£19.00</b>	
				<b>1</b>	2820-041	Light Blue Gloss Paint Per Litre	£19.00	<b>£19.00</b>	
				<b>1</b>	2820-006	Dark Blue Gloss Paint Per Litre	£19.00	<b>£19.00</b>	
		<b>M</b>	Recommend soil and seed is added at the surface edging to reduce potential trip hazards			<b>Labour cost to paint unit*</b>	<b>£480.00</b>		
<b>Speed Bike Spring Mobile on Grass</b>	<b>Ledon</b>	<b>L</b>	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- Fails foot rest requirements for spring mobiles (ref BS EN 1176-6:2008 clause 4.6), no action recommended at present.						
		<b>M</b>	Recommend regular grounds maintenance to combat erosion and reduce potential slip and impact hazards.						
<b>Spring Platform on Grass</b>	<b>Miracle</b>		Satisfactory condition						
 <b>Wicksteed Leisure Ltd</b> <b>Digby St., Kettering</b> <b>Northants, NN16 8YJ</b> <b>Tel: 01536 517 028</b>			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>4.4.2013</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		<b>£95.00</b> <b>£0.00</b> <b>£95.00</b> <b>See sheet 4</b>

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 436		SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW		SHEET 3 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Link Non Bump See Saw on Safety Grass	Wicksteed 2010	VL  M	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- 230mm minimum ground clearance recommended below the seats at the lowest point of travel (ref BS EN 1176-6:2008, clause 4.9), (190mm one end, due to surface levels), no action recommended at present. Lateral movement is indicative of linkage wear, recommend link assemblies are replaced within 12 months	1	5904-003	LNB Re-build kit <b>Labour cost to fit parts*</b>	£273.00 <b>£240.00</b>	<b>£273.00</b>	
4 Way Spring Mobile on Safety Grass	Miracle		Satisfactory condition						
Climbing Frame on Safety Grass	Miracle		Satisfactory condition						
Windsor Picnic Table on Grass	Wicksteed	VL L	Generally satisfactory but monitor ground fixing integrity Recommend timber slats are rubbed down and treated to maintain weather protection.						
3 x Timber Bench ( 2 outside area) on Grass			Satisfactory condition						
Litter Bin Post Mounted			Satisfactory condition						
Fence			Satisfactory condition						
2 x Single Gate		M M	Generally satisfactory but recommend regular grounds maintenance at the entrance points to combat erosion and reduce potential slip hazards. Monitor gate closing rate (note: fast return rate may result in collision or impact hazards), recommend spring tension is adjusted to reduce closing rate as required.						
 <b>Wicksteed Leisure Ltd</b> <b>Digby St., Kettering</b> <b>Northants, NN16 8YJ</b> <b>Tel: 01536 517 028</b>			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>4.4.2013</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		<b>£273.00</b> <b>£95.00</b> <b>£368.00</b> <b>See sheet 4</b>

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:	ORDER NO :- 436	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW			SHEET 4 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>Vehicle Access Gate</b>  <b>Dog Litter Bin (outside area) Post Mounted</b>  <b>General</b>		<b>M</b>	Satisfactory condition ( <i>locked at time of inspection</i> )  Satisfactory condition  Monitor concrete approach footpath from Croft Way, further deterioration may result in trip hazards, recommend footpath repair or upgrade as soon as resources permit  The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			<i>A wide range of signs are available, visit  <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a> or contact  <a href="mailto:sales@wicksteed.co.uk">sales@wicksteed.co.uk</a> for more information</i>		
<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes				INSPECTED BY :- <b>C. Newell</b>  DATE :- <b>4.4.2013</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	<b>£0.00</b> <b>£368.00</b> <b>£368.00</b> <b>£720.00</b> <b>£1,088.00</b>		



Wicksteed Leisure Ltd  
 Digby St., Kettering  
 Northants, NN16 8YJ  
 Tel: 01536 517 028

[www.wicksteed.co.uk](http://www.wicksteed.co.uk)