





Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 318063	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	SHEET 1 of 4
---	--	--	------------------------------	---	------------------------------

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Cableway on Safety Grass	Wicksteed	L	Satisfactory condition Recommend regular grounds maintenance at grass surface adjacent to start ramp to combat erosion and reduce potential slip hazards.					
2 x 5-A Side Goal on Grass	Wicksteed		Satisfactory condition					
BMX Dirt Track on Grass	Natural Play	L	Generally satisfactory but recommend regular grounds maintenance at the riding surface					
Dirt Track Signage			Satisfactory condition					
Shelter on Concrete	Monster	L	Generally satisfactory but one radio control button has been removed <i>(no cables evident)</i>					
Perforated Litter Bin on Grass	Wicksteed		Satisfactory condition					
2.75m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass	Wicksteed	M	Generally satisfactory but recommend excess links are removed to reduce potential snagging hazards <i>(leave two links only through the 'key link' to effect security)</i>	2	5901-002	Flat Rubber Safety Seat	£38.00	£76.00
Pendulum Swing Basket Seat on Safety Grass	Wicksteed 2010		Satisfactory condition <i>Manufacturer recommends the universal joint / swing support bearing assembly should be replaced every 5 years, the assembly is 'sealed for life' unit and maintenance / repairs to the unit should not be attempted (ref BS EN1176-1:2008 clause 6.1.4.2) , recommend</i>					
Double Zigzag Twister on Safety Grass	Wicksteed 2010	L	Satisfactory condition but monitor wear at the bearings <i>(Ensure that the regular greasing of the bearings is included within your annual maintenance schedule.)</i>					

 <small>www.wicksteed.com</small> <small>Register of Play Inspectors International</small> 	Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	INDICATION OF RISK RATING ASSESSMENT			INSPECTED BY :- C. Newell	PARTS SUB TOTAL	£76.00
	H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes			DATE :- 10.4.2014	BALANCE C / FORWARD	£0.00
	M	MEDIUM RISK - See Introductory Notes				PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)	£76.00
	VL/L	VERY LOW & LOW RISK - See Introductory Notes				ESTIMATE TO FIT PARTS * Based on all works ordered	See sheet 4


Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com		ORDER NO :- 318063		SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN		SHEET 2 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Litter Bin on Grass			Satisfactory condition						
Leaning Post on Grass	SMP		Satisfactory condition						
Multi-sports Goal on Tarmac	SMP	M	Generally satisfactory but recommend regular grounds maintenance at the tarmac edging and within the goal mouth to combat erosion and reduce potential trip hazards. Missing frame fixings replaced at time of inspection to restore structural integrity	2	2176-126	M10 X 25 Pentagon Socket Button Head Screw Fitted at time of inspection	£1.79	FOC	
Multi-activity Unit on Grass	Playdale		Consisting of the following:						
Balance Chain		VL	Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.						
Suspended Walkway		VL	Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.						
Balance Beam		L	Monitor wear and condition of the suspended logs.						
Burma Chain Bridge		VL	Satisfactory condition Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.						
Toddler's Multi-play Unit on Grass	Playdale	L	Generally satisfactory but fire damage evident at one low level barrier and tower support post, structural integrity does not appear to be affected at present but monitor for deterioration						
		M	Recommend regular grounds maintenance below the bridge and within the slide tower to combat erosion and reduce potential slip and impact hazards.						
2 x Log Stool on Grass	Unknown		Satisfactory condition (was bench but seat slat has been removed)						
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 10.4.2014		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£0.00 £76.00 £76.00 See sheet 4


Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com		ORDER NO :- 318063		SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN		SHEET 3 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
General: Timber Products		L	Monitor timber condition, climatic conditions are likely to affect the timber appearance (air splits etc), these would not normally affect structural integrity but loose material should be removed or made safe to reduce potential splinter or abrasion hazards <i>(do not fill splits as this can lead to further damage during the natural expansion and contraction process)</i>						
Concrete Litter Bin on Grass	Unknown		Satisfactory condition						
9.4m Embankment Slide on Grass Mound & Tiles with Inlaid Mound Access Steps	Wicksteed	M	Generally satisfactory but recommend regular grounds maintenance at the side of the chute to combat erosion and reduce potential slip and impact hazards, in addition, recommend nettle growth is removed.						
		M	Recommend grass growth is removed from tile joints, in addition, recommend the gaps are filled to reduce potential trip hazards <i>(7 linear metres x 12 ~ 25mm x 40mm deep)</i>	1	6130-201	Black top layer wet pour repair kit Labour cost to fill gaps as detailed* & replace flat seats detailed on sheet 1	£56.00 £160.00	£56.00	
2 x Football Goal on Grass (ground sockets)	Unknown	L	Generally satisfactory but monitor the paint condition			Note:- we are unable to guarantee the longevity of infilling gaps in tiles as tiles will shrink and expand with climatic change			
		L	Recommend regular grounds maintenance to combat erosion and reduce potential slip hazards.						
2 x Park Bench on Concrete Base & Grass			Satisfactory condition						
2 x Park Seat on Concrete Base & Grass		M	Generally satisfactory but recommend missing top and front rails are replaced at one seat to prevent potential snagging hazards at projecting steel bar.						
Brick Encased Litter Bin on Grass			Generally satisfactory but monitor weather damaged at bricks & mortar						
Dig Litter Bin Post Mounted			Satisfactory condition						
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 10.4.2014		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£56.00 £76.00 £132.00 See sheet 4


Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 318063	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	SHEET 4 of 4
--	--	--	------------------------------	---	---

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
General		MH	Unrestricted access to open water source, parental supervision recommended at all times.					
		M	Unrestricted access to car parking area, parental supervision recommended at all times.					
			The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			<i>A wide range of signs are available, visit www.wicksteed.co.uk or contact sales@wicksteed.co.uk for more information</i>		
		M	Access by dogs is not physically prohibited recommend your routine inspection includes monitoring for and removal of animal faeces. <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i>					





 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk	INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :-	PARTS SUB TOTAL	£0.00
		C. Newell DATE :- 10.4.2014	BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	£132.00 £132.00 £160.00 £292.00

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com		ORDER NO :- 318063		SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW		SHEET 1 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Crazy Twister on Safety Grass	Wicksteed 2010		Satisfactory condition (ensure that regular greasing of bearings is included within your annual maintenance schedule.)						
Trim Trail on Grass	Playdale		The individual components are installed as a cluster unit (ref BS EN 1176 -1:2008, clause 4.2.8.3; note 1 and definition 3.19) and consists of the following:-			<i>(these units are approaching end of service, recommend budgetary provision for removal or replacement within 12 months)</i>			
Burma Chain Bridge		M	Generally satisfactory but monitor the timber condition, initial stages of wood rot evident within brace & support logs, structural integrity does not appear to be affected at present.						
Step Post Cluster (3 x 150mm & 1 200mm log)		L	Generally satisfactory but monitor the timber condition and foundation integrity						
Triple Balance Beam		M	Generally satisfactory but monitor the timber condition, wood rot evident within the centre beam and further deterioration could result in splinter hazards, in addition, monitor the foundation integrity						
		M	Recommend redundant chain fixing is removed to reduce potential snagging and collision hazard, ensure redundant fixing hole is sealed when fixing has been removed, to prevent finger entrapment hazard.						
2 x Talking Flower on Grass	Wicksteed 2010		Satisfactory condition						
Mystical World Multi-play Unit on Safety Grass	Wicksteed 2010		Satisfactory condition						
2.3m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass	Wicksteed 2010	M	Generally satisfactory but monitor vandalism damage at seat edges, further damage could expose leading metal edges & create potential impact hazards, recommend one seat is replaced within 12 months	1	5901-002		Flat Rubber Safety Seat	£38.00	£38.00
Spirowhirl Roundabout on Wet Pour	Wicksteed 2010	M	Satisfactory condition (ensure that regular greasing of bearings is included within your annual maintenance schedule.) Recommend soil and seed is added at the surface edging to reduce potential trip hazards						
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 10.4.2014		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£38.00 £0.00 £38.00 See sheet 4

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com		ORDER NO :- 318063		SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW		SHEET 2 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
1.75m 1 Bay 2 Seat Swing 2 x Cradle Seat on Tiles	Wicksteed	M	Generally satisfactory but recommend soil and seed is added at the timber edging to reduce potential trip hazards, in addition, monitor damage at the edging.						
3.4m Pedestal Slide on Tiles	Wicksteed	M	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-						
		L	Fails Head & Torso probe test at the hand and guardrails (ref BS EN 1176-1:2008, clause 4.2.7.2), no action recommended at present.						
		L	Fails Toggle test at chute entrance (BS EN 1176-1:2008, clause 4.2.7.3, no action recommended at present						
		L	Fails Stair criteria (BS EN 1176-1:2008: clause 4.2.9.2), no action recommended at present						
		M	Recommend the painting of this unit is included within your current maintenance schedule (<i>note: ensure surface coatings are free of harmful contents to avoid potential toxic hazards, ref BS EN 1176-1:2008, clause 4.1.1</i>)	2	2820-002	Primer Per Litre	£20.00	£40.00	
				1	2820-004	Red Gloss Paint Per Litre	£20.00	£20.00	
				1	2820-041	Light Blue Gloss Paint Per Litre	£20.00	£20.00	
				1	2820-006	Dark Blue Gloss Paint Per Litre	£20.00	£20.00	
		M	Recommend soil and seed is added at the surface edging to reduce potential trip hazards			Labour cost to paint unit*	£480.00		
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.			& replace flat seat on sheet 1			
Speed Bike Spring Mobile on Grass	Ledon	M	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-						
		L	Fails foot rest requirements for spring mobiles (ref BS EN 1176-6:2008 clause 4.6), no action recommended at present.						
		M	Recommend regular grounds maintenance to combat erosion and reduce potential slip and impact hazards.						
Spring Platform on Grass	Miracle	M	Generally satisfactory but monitor the plastic coating at the platform edge, further deterioration could result in snagging or corrosion hazards, no remedial action possible with this type of coating.						
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 10.4.2014		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£100.00 £38.00 £138.00 See sheet 4

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 318063	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW	SHEET 3 of 4
--	--	--	------------------------------	---	---



DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Link Non Bump See Saw on Safety Grass	Wicksteed 2010	VL	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- 230mm minimum ground clearance recommended below the seats at the lowest point of travel (ref BS EN 1176-6:2008, clause 4.9), (190mm one end, due to surface levels), no action recommended at present.					
4 Way Spring Mobile on Safety Grass	Miracle	VL	Generally satisfactory but monitor the paint condition at the centre plate					
Climbing Frame on Safety Grass	Miracle		Satisfactory condition					
Windsor Picnic Table on Grass	Wicksteed	VL M	Generally satisfactory but monitor ground fixing & foundation integrity Recommend timber slats are rubbed down and treated to maintain weather protection, monitor damage at centre slat and recommend excess bolt threads at one seat slat are trimmed to reduce potential snagging hazards (non-manufacturer's fixings)					
3 x Timber Bench (2 outside area) on Grass		L	Generally satisfactory but monitor the timber condition & foundation integrity, no wood rot evident but could be present below surface level					
Litter Bin Fence Mounted			Satisfactory condition but full at time of inspection					
Fence		L M	Generally satisfactory but monitor the timber condition & foundation integrity at the posts, no wood rot evident but could be present below surface level Recommend damaged 'Lottery Funded' sign is removed to prevent snagging hazard at sharp edges					
Vehicle Access Gate			Satisfactory condition (locked at time of inspection)					


 <small>Register of Play Inspectors International</small> 	Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- C. Newell DATE :- 10.4.2014	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £138.00 £138.00 See sheet 4
---	--	---	--	---	--


Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 318063	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW	SHEET 4 of 4
---	--	--	------------------------------	---	------------------------------

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2 x Single Gate Dog Litter Bin (<i>outside area</i>) Post Mounted General		M L M M	Generally satisfactory but one self closing spring is ineffective and might not exclude animals from the area Recommend regular grounds maintenance at the entrance points to combat erosion and reduce potential slip hazards. Satisfactory condition Monitor concrete approach footpath from Croft Way, further deterioration may result in trip hazards, recommend footpath repair or upgrade as soon as resources permit The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4) The facility is located within an enclosed area but fencing and gates would not physically prohibit access by animals, recommend routine inspections include monitoring for and removal of animal faeces. <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i>			<i>A wide range of signs are available, visit www.wicksteed.co.uk or contact sales@wicksteed.co.uk for more information</i>		



 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk		INDICATION OF RISK RATING ASSESSMENT		INSPECTED BY :-	PARTS SUB TOTAL	£0.00
		H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes	M MEDIUM RISK - See Introductory Notes	VL/L VERY LOW & LOW RISK - See Introductory Notes	C. Newell	BALANCE C / FORWARD
				DATE :-	PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)	£138.00
				10.4.2014	ESTIMATE TO FIT PARTS * Based on all works ordered	£480.00
					TOTAL COST OF WORKS, EXC VAT	£618.00

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail:		ORDER NO :- 318063		SITE ADDRESS :- Cavalry Fields Play Area Fusilier Drive, Weedon, NN7 4TH		SHEET 1 of 2
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
2.25m 1 Bay 2 Seat Swing 1 x Flat & 1 x Cradle Seat on Tiles	SMP	L	Generally satisfactory but monitor paint condition at the top bar						
2.4m Toddler's Slide on Tiles	SMP	L	Generally satisfactory but step design would prevent use by younger children without assistance Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.						
Hippo Spring Mobile on Tiles	SMP	L	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- Fails hand grip & foot rest requirements for spring mobiles (ref BS EN 1176- 6: 2008 clauses 4.6 & 4.7), no action recommended at present.						
		VL	Recommend the panels are cleaned to remove algal residue and reduce dirt transfer to hands and clothing						
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.						
Park Bench on Grass	Unknown	L	Satisfactory condition but located close to fence						
		L	Monitor the paint condition						
Litter Bin on Grass	Unknown		Satisfactory condition.						
Fence			Satisfactory condition.						
Single Gate		M	Satisfactory condition but recommend regular grounds maintenance to combat erosion and reduce potential trip hazards, especially at the kerb edging						
Dog Litter Bin (outside area) Post Mounted			Satisfactory condition.						
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 10.4.2014		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£0.00 £0.00 £0.00 £0.00

Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	318063	Cavalry Fields Play Area Fusilier Drive, Weedon, NN7 4TH			2 of 2
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
General			The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			<i>A wide range of signs are available, visit www.wicksteed.co.uk or contact sales@wicksteed.co.uk for more information</i>		
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- C. Newell DATE :- 10.4.2014	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	£0.00 £0.00 £0.00 £0.00 £0.00		

