







Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET	
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	322473	Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN			1 of 4	
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Cableway on Safety Grass	Wicksteed	L	Generally satisfactory but the traveller braking components are worn, these components are not replaceable as separate items, the free running traveller and seat create no significant hazards, no action recommended at present						
		L	Recommend regular grounds maintenance at grass surface adjacent to start ramp to combat erosion and reduce potential slip hazards.						
2 x 5-A Side Goal on Grass	Wicksteed	L	Generally satisfactory but recommend regular grounds maintenance at the grass surface						
BMX Dirt Track on Grass	Natural Play	L	Generally satisfactory but recommend regular grounds maintenance at the riding surface, security fence crosses the riding surface						
Dirt Track Signage			Satisfactory condition						
2.75m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass	Wicksteed	M	Generally satisfactory but recommend excess links are removed to reduce potential snagging hazards (<i>leave two links only through the 'key link' to effect security</i>)	2	5901F113	Flat Rubber Safety Seat Labour cost to fit seats*	£38.00 £80.00	£76.00	
		M	Monitor vandalism at sides of the seats, recommend both seats are replaced within 12 months						
Pendulum Swing Basket Seat on Safety Grass	Wicksteed 2010		Satisfactory condition (<i>manufacturer recommends the universal joint/ swing support bearing assembly should be replaced every 5 years, the assembly is 'sealed for life' unit and maintenance / repairs to the unit should not be attempted (ref BS EN1176-1:2008 clause 6.1.4.2, last replaced 2012)</i>)						
Double Zigzag Twister on Safety Grass	Wicksteed 2010	L	Satisfactory condition but monitor wear at the bearings (<i>ensure the regular greasing of the bearings is included within your maintenance schedule.</i>)						
Shelter on Concrete	Monster	L	Generally satisfactory but one radio control button has been removed						
		L	One Perspex panel has been removed						
Perforated Litter Bin on Grass	Wicksteed		Satisfactory condition						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 2.4.2015		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£76.00 £0.00 £76.00 See sheet 4



Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 322473	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN			SHEET 3 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Multi-sports Goal on Tarmac	SMP	M	Generally satisfactory but recommend regular grounds maintenance at the tarmac edging and within the goal mouth to combat erosion and reduce potential trip hazards. Security fence rear of the goal has been damaged, allowing access into the restricted area - Client advised 2.4.2015					
Litter Bin on Grass			Satisfactory condition					
2 x Football Goal on Grass (ground sockets)	Unknown	L	Generally satisfactory but monitor the paint condition					
		L	Recommend regular grounds maintenance to combat erosion and reduce potential slip hazards.					
2 x Park Bench on Concrete Base & Grass			Satisfactory condition					
2 x Park Seat on Concrete Base & Grass		M	Generally satisfactory but recommend missing top and front rails are replaced at one seat to prevent potential snagging hazards at projecting steel bar.					
Leaning Post on Grass	SMP		Satisfactory condition					
Brick Encased Litter Bin on Grass			Generally satisfactory but monitor weather damaged at bricks & mortar					
Dig Litter Bin Post Mounted			Satisfactory condition					
General		MH	Unrestricted access to open water source, parental supervision recommended at all times.					
		M	Unrestricted access to car parking area, parental supervision recommended at all times.					
			INDICATION OF RISK RATING ASSESSMENT	INSPECTED BY :-		PARTS SUB TOTAL		£0.00
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes	C. Newell		BALANCE C / FORWARD		£76.00
			M MEDIUM RISK - See Introductory Notes	DATE :-		PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)		£76.00
			VL/L VERY LOW & LOW RISK - See Introductory Notes	2.4.2015		ESTIMATE TO FIT PARTS * Based on all works ordered		See sheet 4



Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 322473	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	SHEET 2 of 4			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
			The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4) M Access by dogs is not physically prohibited recommend your routine inspection includes monitoring for and removal of animal faeces. <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i>			<i>A wide range of signs are available, visit www.wicksteed.co.uk or contact sales@wicksteed.co.uk for more information</i>			
Mound area isolated from access at time of inspection due to soil contamination, advised all equipment in this area is likely to be removed from service,									
Multi-activity Unit on Grass	Playdale		2014 inspection notes retained to maintain report continuity Consisting of the following:						
Balance Chain		VL	Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.						
Suspended Walkway		VL	Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.						
Balance Beam		L	Monitor wear and condition of the suspended logs. Satisfactory condition						
Burma Chain Bridge		VL	Chains fail link gap criteria (ref BS EN 1176-1:2008, clause 4.2.13), no action recommended at present, replace when worn.						
Toddler's Multi-play Unit on Grass	Playdale	L	Generally satisfactory but fire damage evident at one low level barrier and tower support post, structural integrity does not appear to be affected at present but monitor for deterioration						
		M	Recommend regular grounds maintenance below the bridge and within the slide tower to combat erosion and reduce potential slip and impact hazards.						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 2.4.2015		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£0.00 £76.00 £76.00 See sheet 4

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 322473	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	SHEET 4 of 4
--	--	--	------------------------------	---	------------------------------

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2 x Log Stool on Grass	Unknown		Satisfactory condition (<i>was bench but seat slat has been removed</i>)					
Concrete Litter Bin on Grass	Unknown		Satisfactory condition					
9.4m Embankment Slide on Grass Mound & Tiles with Inlaid Mound Access Steps	Wicksteed	M	Generally satisfactory but recommend regular grounds maintenance at the side of the chute to combat erosion and reduce potential slip and impact hazards, in addition, recommend nettle growth is removed.					



 www.wicksteed.co.uk	 Register of Play Inspectors International	Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :-	PARTS SUB TOTAL	£0.00
				C. Newell DATE :- 2.4.2015	BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	£76.00 £76.00 £80.00 £156.00



Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT : - Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com		ORDER NO :- 322473	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW		SHEET 1 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Crazy Twister on Safety Grass	Wicksteed 2010		Satisfactory condition (<i>ensure that regular greasing of bearings is included within your annual maintenance schedule.</i>)					
Trim Trail on Grass	Playdale		The individual components are installed as a cluster unit (ref BS EN 1176 -1:2008, clause 4.2.8.3; note 1 and definition 3.19) and consists of the following:-			<i>(these units are approaching end of service, recommend budgetary provision for removal or replacement within 12 months)</i>		
Burma Chain Bridge		M	Generally satisfactory but extensive wood rot evident in the foot chain support members, the affected logs could be replaced but given the age and condition recommend this unit is removed from service					
Step Post Cluster (3 x 150mm & 1 200mm log)		L	Generally satisfactory but monitor the timber condition and foundation integrity					
Triple Balance Beam		L	Generally satisfactory but monitor the foundation integrity, no wood rot evident but could be present below surface level					
		M	Recommend redundant chain fixing is removed to reduce potential snagging and collision hazard, ensure redundant fixing hole is sealed when fixing has been removed, to prevent finger entrapment hazard.					
General: Timber Products			Monitor timber condition, climatic conditions are likely to affect the timber appearance (air splits etc), these would not normally affect structural integrity but loose material should be removed or made safe to reduce potential splinter or abrasion hazards (<i>do not fill splits as this can lead to further damage during the natural expansion and contraction process</i>)					
		M	Strimmer damage evident around posts, further deterioration could increase risk of wood rot and affect material integrity					
2 x Talking Flower on Grass	Wicksteed 2010		Satisfactory condition					
Mystical World Multi-play Unit on Safety Grass	Wicksteed 2010		Satisfactory condition					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : - C. Newell DATE : - 2.4.2015	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00 See sheet 4	



Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET	
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	322473	Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW			2 of 4	
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
2.3m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass	Wicksteed 2010	M	Generally satisfactory but monitor vandalism damage at seat edges, further damage could expose leading metal edges & create potential impact hazards, recommend one seat is replaced	1	5901F113	Flat Rubber Safety Seat	£38.00	£38.00	
						Labour cost to fit above seat	£40.00		
Spirowhirl Roundabout on Wet Pour	Wicksteed 2010		Satisfactory condition (<i>ensure that regular greasing of bearings is included within your annual maintenance schedule.</i>)						
1.75m 1 Bay 2 Seat Swing 2 x Cradle Seat on Tiles	Wicksteed	M	Generally satisfactory but monitor wear at the seat frames (<i>perished or flaking rubber could cause choking if swallowed</i>)						
		M	Recommend soil and seed are added at the timber edging to reduce potential trip hazards, in addition, monitor damage at the edging.						
3.4m Pedestal Slide on Tiles	Wicksteed		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-						
		L	Fails Head & Torso probe test at the hand and guardrails (ref BS EN 1176-1:2008, clause 4.2.7.2), no action recommended at present.						
		L	Fails Toggle test at chute entrance (BS EN 1176-1:2008, clause 4.2.7.3, no action recommended at present						
		L	Fails Stair criteria (BS EN 1176-1:2008: clause 4.2.9.2), no action recommended at present						
		M	Recommend the painting of this unit is included within your current maintenance schedule (<i>note: ensure surface coatings are free of harmful contents to avoid potential toxic hazards, ref BS EN 1176-1:2008, clause 4.1.1</i>)	2	2820-002	Primer Per Litre	£20.00	£40.00	
				1	2820-004	Red Gloss Paint Per Litre	£20.00	£20.00	
				1	2820-041	Light Blue Gloss Paint Per Litre	£20.00	£20.00	
		1	2820-006	Dark Blue Gloss Paint Per Litre	£20.00	£20.00			
		M	Recommend soil and seed is added at the surface edging to reduce potential trip hazards			Labour cost to paint unit	£480.00		
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.						
Speed Bike Spring Mobile on Grass	Ledon		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-						
		L	Fails foot rest requirements for spring mobiles (ref BS EN 1176-6:2008 clause 4.6), no action recommended at present.						
		M	Recommend regular grounds maintenance to combat erosion and reduce potential slip and impact hazards.						



INDICATION OF RISK RATING ASSESSMENT			INSPECTED BY :-	PARTS SUB TOTAL	£138.00
H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes		C. Newell	BALANCE C / FORWARD	£0.00
M	MEDIUM RISK - See Introductory Notes		DATE :-	PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)	£138.00
VL/L	VERY LOW & LOW RISK - See Introductory Notes		2.4.2015	ESTIMATE TO FIT PARTS * Based on all works ordered	See sheet 4



Wicksteed Leisure Ltd
Digby St., Kettering
Northants, NN16 8YJ
Tel: 01536 517 028

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT : - Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 322473	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW			SHEET 3 of 4	
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Spring Platform on Grass	Miracle	M	Generally satisfactory but monitor the plastic coating at the platform edge, further deterioration could result in snagging or corrosion hazards, no remedial action possible with this type of coating.						
Link Non Bump See Saw on Safety Grass	Wicksteed 2010	VL	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- 230mm minimum ground clearance recommended below the seats at the lowest point of travel (ref BS EN 1176-6:2008, clause 4.9), (190mm one end, due to surface levels), no action recommended at present.						
4 Way Spring Mobile on Safety Grass	Miracle	VL	Generally satisfactory but monitor the paint condition at the centre plate						
Climbing Frame on Safety Grass	Miracle		Satisfactory condition						
Windsor Picnic Table on Grass	Wicksteed	VL M	Generally satisfactory but monitor ground fixing & foundation integrity Recommend timber slats are rubbed down and treated to maintain weather protection, monitor damage at centre slat and recommend excess bolt threads at one seat slat are trimmed to reduce potential snagging hazards (<i>non-manufacturer's fixings</i>)						
3 x Timber Bench (2 outside area) on Grass		L	Generally satisfactory but monitor the timber condition & foundation integrity, no wood rot evident but could be present below surface level						
Litter Bin Fence Mounted			Satisfactory condition						
Fence		L	Generally satisfactory but monitor the timber condition & foundation integrity at the posts, no wood rot evident but could be present below surface level						
Vehicle Access Gate			Satisfactory condition (<i>locked at time of inspection</i>)						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : - C. Newell DATE : - 2.4.2015		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		£0.00 £138.00 £138.00 See sheet 4



Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	322473	Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW			4 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2 x Single Gate Dog Litter Bin (<i>outside area</i>) Post Mounted General			Satisfactory condition Satisfactory condition M Monitor concrete approach footpath from Croft Way, further deterioration may result in trip hazards, recommend footpath repair or upgrade as soon as resources permit The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4) M The facility is located within an enclosed area but fencing and gates would not physically prohibit access by animals, recommend routine inspections include monitoring for and removal of animal faeces. <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i>			<i>A wide range of signs are available, visit www.wicksteed.co.uk or contact sales@wicksteed.co.uk for more information</i> 		
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- C. Newell DATE :- 2.4.2015	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	£0.00 £138.00 £138.00 £520.00 £658.00		

Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	322473	Cavalry Fields Play Area Fusilier Drive, Weedon, NN7 4TH			1 of 2
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2.25m 1 Bay 2 Seat Swing 1 x Flat & 1 x Cradle Seat on Tiles	SMP	L	Generally satisfactory but monitor paint condition at the top bar and seat frames					
2.4m Toddler's Slide on Tiles	SMP	M	Generally satisfactory but step design would prevent use by younger children without assistance, in addition, recommend step panels are cleaned to remove algal residue and reduce potential slip hazards					
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.					
Hippo Spring Mobile on Tiles	SMP		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-					
		L	Fails hand grip & foot rest requirements for spring mobiles (ref BS EN 1176- 6: 2008 clauses 4.6 & 4.7), no action recommended at present.					
		VL	Recommend the panels are cleaned to remove algal residue and reduce dirt transfer to hands and clothing					
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.					
Park Bench on Grass	Record	L	Satisfactory condition but located close to fence					
		L	Monitor the paint condition					
Litter Bin on Grass	Unknown		Satisfactory condition.					
Fence			Satisfactory condition.					
Single Gate		L	Satisfactory condition but recommend regular grounds maintenance to combat erosion and reduce potential trip hazards, especially at the kerb edging					
Dog Litter Bin (outside area) Post Mounted			Satisfactory condition.					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- C. Newell DATE :- 2.4.2015	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00 £0.00	

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 322473	SITE ADDRESS :- Cavalry Fields Play Area Fusilier Drive, Weedon, NN7 4TH	SHEET 2 of 2
--	--	--	--	------------------------------	--	---

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
General			The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			<i>A wide range of signs are available, visit www.wicksteed.co.uk or contact sales@wicksteed.co.uk for more information</i>		



 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk	 INDICATION OF RISK RATING ASSESSMENT H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :-	PARTS SUB TOTAL	£0.00
		C. Newell	BALANCE C / FORWARD	£0.00
		DATE :-	PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)	£0.00
		2.4.2015	ESTIMATE TO FIT PARTS * Based on all works ordered	£0.00
			TOTAL COST OF WORKS, EXC VAT	£0.00