







Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET	
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	327493	Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN			1 of 4	
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
<b>Cableway on Safety Grass</b>	<b>Wicksteed</b>	<b>MH</b>	Recommend end stop spring is reset on main cable to reduce collision hazards with frame. Minimum 2m clearance is recommended when seat is pulled through 45 degrees at end stop (Ref BS EN 1176:2008 Part 4 Section 4.14)			See below for labour cost to reset end stop			
		<b>L</b>	Generally satisfactory but the traveller braking components are worn, these components are not replaceable as separate items, the free running traveller and seat create no significant hazards, no action recommended at present						
		<b>L</b>	Recommend regular grounds maintenance at grass surface adjacent to start ramp to combat erosion and reduce potential slip hazards.						
<b>2 x 5-A Side Goal on Grass</b>	<b>Wicksteed</b>	<b>L</b>	Generally satisfactory but recommend regular grounds maintenance at the grass surface						
<b>BMX Dirt Track on Grass</b>	<b>Natural Play</b>	<b>L</b>	Generally satisfactory but recommend regular grounds maintenance at the riding surface, security fence crosses the riding surface						
<b>Dirt Track Signage</b>			Satisfactory condition						
<b>2.75m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass</b>	<b>Wicksteed</b>	<b>L</b>	Generally satisfactory but recommend excess links are removed to reduce potential snagging hazards ( <i>leave two links only through the 'key link' to effect security</i> )	<b>2</b>	5901F113	Flat Rubber Safety Seat <b>Labour cost to fit seats and reset end stop on Cableway*</b>	£40.00 <b>£160.00</b>	<b>£80.00</b>	
		<b>M</b>	Monitor vandalism at sides of the seats, recommend both seats are replaced within 12 months						
<b>Pendulum Swing Basket Seat on Safety Grass</b>	<b>Wicksteed 2010</b>		Satisfactory condition ( <i>manufacturer recommends the universal joint/ swing support bearing assembly should be replaced every 5 years, the assembly is 'sealed for life' unit and maintenance / repairs to the unit should not be attempted (ref BS EN1176-1:2008 clause 6.1.4.2, last replaced 2012)</i> )						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>A J HAYES</b> DATE :- <b>30. 03. 2016</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		<b>£80.00</b> <b>£0.00</b> <b>£80.00</b> <b>See sheet 4</b>



Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT : - Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com		ORDER NO :- 327493		SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN		SHEET 2 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Double Zigzag Twister on Safety Grass	Wicksteed 2010	L	Satisfactory condition but monitor wear at the bearings ( <i>ensure the regular greasing of the bearings is included within your maintenance schedule.</i> )						
Shelter on Concrete	Monster	L L	Generally satisfactory but one radio control button has been removed All Perspex panels have been removed.						
Perforated Litter Bin on Grass	Wicksteed		Satisfactory condition						
Multi-sports Goal on Tarmac	SMP	L	Generally satisfactory but recommend regular grounds maintenance at the tarmac edging and within the goal mouth to combat erosion and reduce potential trip hazards. Security fence rear of the goal has been damaged, allowing access into the restricted area.						
2 x Football Goals on Grass ( <i>ground sockets</i> )	Unknown	M L L	Recommend both goals are reset in new ground sockets to ensure structural integrity is maintained. Monitor the paint condition. Recommend regular grounds maintenance to combat erosion and reduce potential slip hazards.						
2 x Park Bench on Concrete Base & Grass			Satisfactory condition						
Park Seat			Satisfactory condition						
General		MH M	Unrestricted access to open water source, parental supervision recommended at all times. Unrestricted access to car parking area, parental supervision recommended at all times.						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>A J HAYES</b> DATE :- <b>30. 03. 2016</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		<b>£0.00</b> <b>£80.00</b> <b>£80.00</b> <b>See sheet 4</b>



Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 327493	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN			SHEET 3 of 4	
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
			<p>The provision of a sign (pictogram) is recommended giving the following information:</p> <p>a) General emergency telephone number  b) Telephone number to contact maintenance personnel  c) Name of the playground  d) Address of the playground  e) Other relevant local information, if applicable  (ref: BS EN 1176-7:2008 clause 8.2.4)</p> <p><b>M</b> Access by dogs is not physically prohibited recommend your routine inspection includes monitoring for and removal of animal faeces.  <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i></p>			<i>A wide range of signs are available, visit <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a> or contact <a href="mailto:sales@wicksteed.co.uk">sales@wicksteed.co.uk</a> for more information</i>			
<b>Mound area isolated from access at time of inspection due to soil contamination, advised all equipment in this area is likely to be removed from service, as advised in 2014.</b>									
<b>Multi-activity Unit on Grass</b> <b>Balance Chain</b> <b>Suspended Walkway</b> <b>Balance Beam</b> <b>Burma Chain Bridge</b>	<b>Playdale</b>	<b>MH</b>	<p>Some sections of Herras fencing were found to be open. Ensure these are kept secure at all times, to prevent unauthorised to the restricted area.</p> <p>Not inspected - area fenced off out of use.</p>						
<b>Toddler's Multi-play Unit on Grass</b>	<b>Playdale</b>		Not inspected - area fenced off out of use.						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>A J HAYES</b> DATE :- <b>30. 03. 2016</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		<b>£0.00</b> <b>£80.00</b> <b>£80.00</b> <b>See sheet 4</b>

<b>Certified Inspection Report for:</b> <b>Weedon Bec Parish Council</b> 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL		<b>CONTACT :-</b> Sue Halkett <b>Tel:</b> 01327 341 057 <b>E-mail:</b> weedonbecpc@btinternet.com	<b>ORDER NO :-</b> 327493	<b>SITE ADDRESS :-</b> Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	<b>SHEET</b> 4 of 4
------------------------------------------------------------------------------------------------------------------------------------------	--	------------------------------------------------------------------------------------------------------------	------------------------------	---------------------------------------------------------------------------------------------------	------------------------------

DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2 x Log Stool on Grass	unknown		Not inspected - area fenced off out of use.					
Concrete Litter Bin on Grass	unknown		Not inspected - area fenced off out of use.					
9.4m Embankment Slide on Grass Mound & Tiles with Inlaid Mound Access Steps	Wicksteed		Not inspected - area fenced off out of use.					



  <p>Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a></p>	<b>INDICATION OF RISK RATING ASSESSMENT</b>			<b>INSPECTED BY :-</b> A J HAYES <b>DATE :-</b> 30. 03. 2016	<b>PARTS SUB TOTAL</b>	<b>£0.00</b>
	H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	<b>BALANCE C / FORWARD</b> <b>PARTS TOTAL EXC. CARRIAGE &amp; VAT. (E&amp;O.E.)</b> <b>ESTIMATE TO FIT PARTS * Based on all works ordered</b> <b>TOTAL COST OF WORKS, EXC VAT</b>	<b>£80.00</b> <b>£80.00</b> <b>£160.00</b> <b>£240.00</b>			

Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET	
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	327493	Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW			1 of 4	
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Crazy Twister on Safety Grass	Wicksteed 2010		Satisfactory condition ( <i>ensure that regular greasing of bearings is included within your annual maintenance schedule.</i> )						
Trim Trail on Grass	Playdale		The individual components are installed as a cluster unit (ref BS EN 1176 -1:2008, clause 4.2.8.3; note 1 and definition 3.19) and consists of the following:-			<i>(these units are approaching end of service, recommend budgetary provision for removal or replacement within 12 months)</i>			
Burma Chain Bridge		MH	Extensive wood rot evident in the end cross logs. Replacement of individual parts is unlikely to be cost effective. Recommend this item is removed from service.						
Step Post Cluster (3 x 150mm & 1 200mm log)		L	Generally satisfactory but monitor the timber condition and foundation integrity						
Triple Balance Beam		L	Generally satisfactory but monitor the foundation integrity, no wood rot evident but could be present below surface level						
		M	Recommend redundant chain fixing is removed to reduce potential snagging and collision hazard, ensure redundant fixing hole is sealed when fixing has been removed, to prevent finger entrapment hazard.						
General: Timber Products			Monitor timber condition, climatic conditions are likely to affect the timber appearance (air splits etc), these would not normally affect structural integrity but loose material should be removed or made safe to reduce potential splinter or abrasion hazards ( <i>do not fill splits as this can lead to further damage during the natural expansion and contraction process</i> )						
		M	Strimmer damage evident around posts, further deterioration could increase risk of wood rot and affect material integrity						
2 x Talking Flower on Grass	Wicksteed 2010		Satisfactory condition, but 1 item is slightly bent.						
Mystical World Multi-play Unit on Safety Grass	Wicksteed 2010		Satisfactory condition.						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>A J HAYES</b> DATE :- <b>30. 03. 2016</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>See sheet 4</b>

Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	327493	Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW			2 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2.3m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass	Wicksteed 2010	M	Generally satisfactory but monitor vandalism damage at seat edges, further damage could expose leading metal edges & create potential impact hazards, recommend one seat is replaced	1	5901F113	Flat Rubber Safety Seat <b>Labour cost to fit above seat</b>	£40.00 <b>£40.00</b>	<b>£40.00</b>
		L	Monitor minor damage to the wetpour playing surface. Manufacturer recommends bearings are greased annually.					
Spirowhirl Roundabout on Wet Pour	Wicksteed 2010	L	Monitor minor damage to the wetpour playing surface. Manufacturer recommends bearings are greased annually.					
1.75m 1 Bay 2 Seat Swing 2 x Cradle Seat on Tiles	Wicksteed	M	Generally satisfactory but monitor wear at the seat frames <i>(perished or flaking rubber could cause choking if swallowed)</i>					
		M	Recommend soil and seed are added at the timber edging to reduce potential trip hazards, in addition, monitor damage at the edging.					
3.4m Pedestal Slide on Tiles	Wicksteed		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-					
		L	Fails Head & Torso probe test at the hand and guardrails (ref BS EN 1176-1:2008, clause 4.2.7.2), no action recommended at present.					
		L	Fails Toggle test at chute entrance (BS EN 1176-1:2008, clause 4.2.7.3, no action recommended at present					
		L	Fails Stair criteria (BS EN 1176-1:2008: clause 4.2.9.2), no action recommended at present					
		M	Recommend the painting of this unit is included within your current maintenance schedule <i>(note: ensure surface coatings are free of harmful contents to avoid potential toxic hazards, ref BS EN 1176-1:2008, clause 4.1.1)</i>	2	2820-002	Primer Per Litre	£20.00	<b>£40.00</b>
		1	2820-004	Red Gloss Paint Per Litre	£20.00	<b>£20.00</b>		
		1	2820-041	Light Blue Gloss Paint Per Litre	£20.00	<b>£20.00</b>		
1	2820-006	Dark Blue Gloss Paint Per Litre	£20.00	<b>£20.00</b>				
		M	Recommend soil and seed is added at the surface edging to reduce potential trip hazards			<b>Labour cost to paint unit</b>	<b>£480.00</b>	
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.					
Speed Bike Spring Mobile on Grass	Ledon		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-					
		L	Fails foot rest requirements for spring mobiles (ref BS EN 1176-6:2008 clause 4.6), no action recommended at present.					
		M	Recommend regular grounds maintenance to combat erosion and reduce potential slip and impact hazards.					



Wicksteed Leisure Ltd  
Digby St., Kettering  
Northants, NN16 8YJ  
Tel: 01536 517 028



**INDICATION OF RISK RATING ASSESSMENT**




H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes  
M MEDIUM RISK - See Introductory Notes  
VL/L VERY LOW & LOW RISK - See Introductory Notes

INSPECTED BY :-  
**A J HAYES**  
DATE :-  
**30. 03. 2016**



PARTS SUB TOTAL  
BALANCE C / FORWARD  
PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.)  
ESTIMATE TO FIT PARTS \* Based on all works ordered



**£140.00**  
**£0.00**  
**£140.00**  
**See sheet 4**

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT : - Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 327493	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW	SHEET 3 of 4		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Spring Platform on Grass	Miracle	M	Generally satisfactory but monitor the plastic coating at the platform edge, further deterioration could result in snagging or corrosion hazards, no remedial action possible with this type of coating.					
Link Non Bump See Saw on Safety Grass	Wicksteed 2010	VL	Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- 230mm minimum ground clearance recommended below the seats at the lowest point of travel (ref BS EN 1176-6:2008, clause 4.9), (160mm one end, due to surface levels), no action recommended at present.					
4 Way Spring Mobile on Safety Grass	Miracle	VL	Generally satisfactory but monitor the paint condition at the centre plate					
Climbing Frame on Safety Grass	Miracle		Satisfactory condition					
Windsor Picnic Table on Grass	Wicksteed	VL M	Generally satisfactory but monitor ground fixing & foundation integrity Recommend timber slats are rubbed down and treated to maintain weather protection, monitor damage at centre slat and recommend excess bolt threads at one seat slat are trimmed to reduce potential snagging hazards ( <i>non-manufacturer's fixings</i> )					
3 x Timber Bench ( 2 outside area) on Grass		L	Generally satisfactory but monitor the timber condition & foundation integrity, no wood rot evident but could be present below surface level					
Litter Bin Fence Mounted			Satisfactory condition					
Timber Fence		L	Generally satisfactory but monitor the timber condition & foundation integrity at the posts, no wood rot evident but could be present below surface level					
Vehicle Access Gate			Satisfactory condition ( <i>locked at time of inspection</i> )					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- <b>A J HAYES</b> DATE :- <b>30. 03. 2016</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£0.00</b> <b>£140.00</b> <b>£140.00</b> <b>See sheet 4</b>		

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 327493	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW			SHEET 4 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>2 x Single Gates</b>  <b>Dog Litter Bin (outside area)</b> <b>Post Mounted</b>  <b>General</b>			<p>Satisfactory condition</p> <p>Satisfactory condition</p> <p><b>M</b> Monitor concrete approach footpath from Croft Way, further deterioration may result in trip hazards, recommend footpath repair or upgrade as soon as resources permit</p> <p>The provision of a sign (pictogram) is recommended giving the following information:  a) General emergency telephone number  b) Telephone number to contact maintenance personnel  c) Name of the playground  d) Address of the playground  e) Other relevant local information, if applicable  (ref: BS EN 1176-7:2008 clause 8.2.4)</p> <p><b>M</b> The facility is located within an enclosed area but fencing and gates would not physically prohibit access by animals, recommend routine inspections include monitoring for and removal of animal faeces.  <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i></p>			<p><i>A wide range of signs are available, visit <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a> or contact <a href="mailto:sales@wicksteed.co.uk">sales@wicksteed.co.uk</a> for more information</i></p> 		
  <p>Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028</p> <p><a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a></p>			<p><b>INDICATION OF RISK RATING ASSESSMENT</b></p> <p>H/MH HIGH &amp; MEDIUM HIGH RISK - See Introductory Notes</p> <p>M MEDIUM RISK - See Introductory Notes</p> <p>VL/L VERY LOW &amp; LOW RISK - See Introductory Notes</p>	<p>INSPECTED BY :- <b>A J HAYES</b></p> <p>DATE :- <b>30. 03. 2016</b></p>	<p>PARTS SUB TOTAL</p> <p>BALANCE C / FORWARD</p> <p>PARTS TOTAL EXC. CARRIAGE &amp; VAT. (E&amp;O.E.)</p> <p>ESTIMATE TO FIT PARTS * Based on all works ordered</p> <p>TOTAL COST OF WORKS, EXC VAT</p>	<p><b>£0.00</b></p> <p><b>£140.00</b></p> <p><b>£140.00</b></p> <p><b>£520.00</b></p> <p><b>£660.00</b></p>		



Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	327493	Cavalry Fields Play Area Fusilier Drive, Weedon, NN7 4TH			1 of 2
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2.25m 1 Bay 2 Seat Swing 1 x Flat & 1 x Cradle Seat on Tiles	SMP	L	Generally satisfactory but monitor paint condition at the top bar and seat frames.					
2.4m Toddler's Slide on Tiles	SMP	M	Generally satisfactory but step design would prevent use by younger children without assistance, in addition, recommend step panels are cleaned to remove algal residue and reduce potential slip hazards					
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.					
Hippo Spring Mobile on Tiles	SMP		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-					
		L	Fails hand grip & foot rest requirements for spring mobiles (ref BS EN 1176- 6: 2008 clauses 4.6 & 4.7), no action recommended at present.					
		VL	Recommend the panels are cleaned to remove algal residue and reduce dirt transfer to hands and clothing					
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.					
		L	2 hole caps in the seat are missing. Price to replace hole caps is available on request.					
Park Bench on Grass	Record	L	Satisfactory condition but located close to fence					
		L	Monitor the paint condition					
Litter Bin on Grass	unknown		Satisfactory condition.					
Metal Bow Top Fence	unknown		Satisfactory condition.					
Single Gate	unknown	L	Recommend broken spring is replaced to ensure gate is self-closing.					
		L	Recommend regular grounds maintenance to combat erosion and reduce potential trip hazards, especially at the kerb edging.					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>A J HAYES</b> DATE :- <b>30. 03. 2016</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>£0.00</b>	

Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	327493	Cavalry Fields Play Area Fusilier Drive, Weedon, NN7 4TH			2 of 2
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Dog Litter Bin ( <i>outside area</i> ) Post Mounted  General		L	Satisfactory condition.  The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			<i>A wide range of signs are available, visit <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a> or contact <a href="mailto:sales@wicksteed.co.uk">sales@wicksteed.co.uk</a> for more information</i>		
		M	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces)					
  <b>Wicksteed Leisure Ltd</b> Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>A J HAYES</b> DATE :- <b>30. 03. 2016</b>	<b>PARTS SUB TOTAL</b> <b>BALANCE C / FORWARD</b> <b>PARTS TOTAL EXC. CARRIAGE &amp; VAT. (E&amp;O.E.)</b> <b>ESTIMATE TO FIT PARTS * Based on all works ordered</b> <b>TOTAL COST OF WORKS, EXC VAT</b>	<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>£0.00</b>	

