













Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET		
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	331730	Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN			1 of 3		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL		
Cableway on Safety Grass	Wicksteed	L	Generally satisfactory but the traveller braking components are wearing							
		L	Monitor wear at the traveller end plates							
		L	monitor minor damage at the seat edge							
		M	Wood rot evident at one ramp foot grip slat, recommend this is replaced and monitor timber condition at the remaining slats	1	S763-SPEC	100mm 1/2 Rd Log x 900mm long	£15.00	£15.00		
		2	2176-129	M10 x 50 Pent Socket Button Head Screw	£1.79	£3.58				
		2	2193-006	M10 Hexagon Nut	£0.90	£1.80				
2 x 5-A Side Goal on Grass	Wicksteed	L	Recommend regular grounds maintenance at grass surface adjacent to start ramp to combat erosion and reduce potential slip hazards.	2	2215-508	M10 Washer	£0.45	£0.90		
		2	2611-031	Plastic Dome Cap and Base - Black	£0.90	£1.80				
							<b>Labour cost to fit parts*</b>	<b>£40.00</b>		
		L	Generally satisfactory but recommend regular grounds maintenance at the grass surface							
		L	Generally satisfactory but recommend regular grounds maintenance at the riding surface, security fence crosses the riding surface							
		L	Generally satisfactory but recommend excess links are removed to reduce potential snagging hazards ( <i>leave two links only through the 'key link' to effect security</i> )							
BMX Dirt Track on Grass	Natural Play	L	Both seats are worn or damaged, recommend they are replaced as soon as possible	2	5901F113	Flat Rubber Safety Seat	£40.00	£80.00		
		M	Recommend loose safety grass matting edges are secured with cable ties to reduce potential trip hazards and vandalism	8	2490-033	Tie For Wicksteed Grass Mats	£0.27	£2.16		
							<b>Labour cost to fit seats &amp; secure matting edges*</b>	<b>£120.00</b>		
		M	Generally satisfactory ( <i>manufacturer recommends the universal joint swing support bearing assembly should be replaced every 5 years, the assembly is 'sealed for life' unit and maintenance / repairs to the unit should not be attempted (ref BS EN1176-1:2008 clause 6.1.4.2, last replaced 2012)</i> ), recommend the support bearing assembly is replaced within 12 months	1	5901-070	UJ Assy (4 Chains c/w fixings)	£832.00	£832.00		
2.75m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass	Wicksteed	M	Generally satisfactory but recommend regular grounds maintenance at the grass surface							
		M	Generally satisfactory ( <i>manufacturer recommends the universal joint swing support bearing assembly should be replaced every 5 years, the assembly is 'sealed for life' unit and maintenance / repairs to the unit should not be attempted (ref BS EN1176-1:2008 clause 6.1.4.2, last replaced 2012)</i> ), recommend the support bearing assembly is replaced within 12 months							
Pendulum Swing Basket Seat on Safety Grass	Wicksteed 2010	M	Generally satisfactory but monitor wear at the bearings and foundation integrity ( <i>ensure the regular greasing of the bearings is included within your maintenance schedule.</i> )							
		M	Generally satisfactory but monitor wear at the bearings and foundation integrity ( <i>ensure the regular greasing of the bearings is included within your maintenance schedule.</i> )							
Double Zigzag Twister on Safety Grass	Wicksteed 2010	L	Generally satisfactory but monitor wear at the bearings and foundation integrity ( <i>ensure the regular greasing of the bearings is included within your maintenance schedule.</i> )							
		L	Generally satisfactory but monitor wear at the bearings and foundation integrity ( <i>ensure the regular greasing of the bearings is included within your maintenance schedule.</i> )							
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes			INSPECTED BY :- <b>C. Newell</b> DATE :- <b>23.3.2017</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		<b>£937.24</b> <b>£0.00</b> <b>£937.24</b> <b>See sheet 3</b>


Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	331730	Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN			2 of 3
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Shelter on Concrete	Monster	L	Generally satisfactory but radio control buttons and one Perspex panel have been removed					
		M	Monitor paint condition and minor damage at the seat panels, recommend rough edges are removed and made safe to reduce potential snagging hazards					
Perforated Litter Bin Frame on Grass	Wicksteed	M	Generally satisfactory but recommend the missing frame plugs and liner basket are replaced ( <i>litter hazard in the area at time of inspection</i> )	3	2611-003	Plastic End Cap 1" Ref255	£0.87	£2.61
				1	4151-005	Bin Assembly	£161.00	£161.00
				1	2461-001	Litter Bin Padlock	£18.00	£18.00
						<b>Labour cost to fit parts*</b>	<b>£40.00</b>	
Multi-sports Goal on Tarmac	SMP	M	Generally satisfactory but recommend regular grounds maintenance at the tarmac edging and within the goal mouth to combat erosion and reduce potential trip hazards.					
Leaning Post on Grass	SMP		Satisfactory condition					
2 x Football Goal on Grass ( <i>ground sockets</i> )	Unknown	L	Generally satisfactory but monitor the paint condition					
		L	Monitor the foundation integrity at the ground sockets					
		L	Recommend regular grounds maintenance to combat erosion and reduce potential slip hazards.					
2 x Park Bench on Concrete Base & Grass	Unknown		Satisfactory condition					
2 x Park Seat on Concrete Base & Grass	Unknown	M	Generally satisfactory but recommend missing top and front rails are replaced at one seat to prevent potential snagging hazards at projecting steel bar.					
		L	Monitor the timber condition at the slats					
Brick Encased Litter Bin on Grass	Unknown	L	Generally satisfactory but monitor weather damaged at bricks & mortar					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>23.3.2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£181.61</b> <b>£937.24</b> <b>£1,118.85</b> <b>See sheet 3</b>	

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT :- Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 331730	SITE ADDRESS :- Jubilee Field Bridge Street, Weedon Bec Northamptonshire, NN7 4PN	SHEET 3 of 3		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Dig Litter Bin Post Mounted			Satisfactory condition  The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)  <b>M</b> Access by dogs is not physically prohibited recommend your routine inspection includes monitoring for and removal of animal faeces. <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i>  Mound area at back of the field has been isolated from access, advised any remaining equipment or furniture in this area is to be removed from service  <b>MH</b> Unrestricted access to open water source, parental supervision recommended at all times.  <b>M</b> Unrestricted access to car parking area, parental supervision recommended at all times.			<i>A wide range of signs are available, visit <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a> or contact <a href="mailto:sales@wicksteed.co.uk">sales@wicksteed.co.uk</a> for more information</i>		
General								
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- <b>C. Newell</b> DATE :- <b>23.3.2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR COST TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	<b>£0.00</b> <b>£1,118.85</b> <b>£1,118.85</b> <b>£320.00</b> <b>£1,438.85</b>		

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT : - Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com		ORDER NO :- 331730		SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW		SHEET 1 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Crazy Twister on Safety Grass	Wicksteed 2010		Satisfactory condition <i>(ensure that regular greasing of bearings is included within your annual maintenance schedule.)</i>						
Trim Trail on Grass	Playdale		The individual components are installed as a cluster unit (ref BS EN 1176 -1:2008, clause 4.2.8.3; note 1 and definition 3.19) and consists of the following:-			<i>(these units are approaching end of service, recommend budgetary provision for removal or replacement within 12 months)</i>			
Step Post Cluster (3 x 150mm & 1 200mm log)		L	Generally satisfactory but monitor the timber condition and foundation integrity						
Triple Balance Beam		L	Generally satisfactory but monitor the foundation integrity at the centre post, no wood rot evident but could be present below surface level						
		M	Recommend redundant chain fixing is removed to reduce potential snagging and collision hazard, ensure redundant fixing hole is sealed when fixing has been removed, to prevent finger entrapment hazard.						
General: Timber Products		M	Monitor timber condition, climatic conditions are likely to affect the timber appearance (air splits etc.), these would not normally affect structural integrity but loose material should be removed or made safe to reduce potential splinter or abrasion hazards <i>(do not fill splits as this can lead to further damage during the natural expansion and contraction process)</i>						
2 x Talking Flower on Grass	Wicksteed 2010		Satisfactory condition						
Mystical World Multi-play Unit on Safety Grass	Wicksteed 2010	L	Generally satisfactory but graffiti present at rear of the 'Spooky Pairs' game panel at time of inspection						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : - <b>C. Newell</b> DATE : - <b>23.3.2017</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>See sheet 4</b>



Certified Inspection Report for:			CONTACT : -	ORDER NO :-	SITE ADDRESS :-			SHEET	
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	331730	Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW			2 of 4	
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
2.3m 1 Bay 2 Seat Swing 2 x Flat Seat on Safety Grass	Wicksteed 2010	M	Generally satisfactory but one seat is worn & damaged, recommend the affected seat is replaced as soon as possible	1	5901F113	Flat Rubber Safety Seat <b>Labour cost to fit seat</b>	£40.00 <b>See below</b>	<b>£40.00</b>	
Spirowhirl Roundabout on Wet Pour	Wicksteed 2010		Satisfactory condition ( <i>ensure that regular greasing of bearings is included within your annual maintenance schedule.</i> )						
1.75m 1 Bay 2 Seat Swing 2 x Cradle Seat on Tiles	Wicksteed	M	Generally satisfactory but one seat is worn, recommend the affected seat is replaced as soon as possible ( <i>perished or flaking rubber could cause choking if swallowed</i> )	1	5901-048	Single Tier Rubber Cradle Seat (2007) <b>Labour cost to fit one flat &amp; one cradle seat * (if carried out with works at Jubilee Field)</b>	£125.00 <b>£80.00</b>	<b>£125.00</b>	
3.4m Pedestal Slide on Tiles	Wicksteed		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- L Fails Head & Torso probe test at the hand and guardrails (ref BS EN 1176-1:2008, clause 4.2.7.2), no action recommended at present. L Fails Toggle test at chute entrance (BS EN 1176-1:2008, clause 4.2.7.3, no action recommended at present L Fails Stair criteria (BS EN 1176-1:2008: clause 4.2.9.2), no action recommended at present L Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards. L Monitor the timber condition at the tile retention edging						
Speed Bike Spring Mobile on Grass	Ledon		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:- L Fails foot rest requirements for spring mobiles (ref BS EN 1176-6: 2008 clause 4.6), no action recommended at present. M Recommend regular grounds maintenance to combat erosion and reduce potential slip and impact hazards ( <i>note: ground fixing plate and clamp assembly set below the grass surface</i> )						
Link Non Bump See Saw on Safety Grass	Wicksteed 2010		Satisfactory condition						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : - <b>C. Newell</b> DATE : - <b>23.3.2017</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered		<b>£165.00</b> <b>£0.00</b> <b>£165.00</b> <b>See sheet 4</b>

Certified Inspection Report for: Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			CONTACT : - Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	ORDER NO :- 331730	SITE ADDRESS :- Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW			SHEET 3 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Spring Platform on Grass	Miracle	M	Generally satisfactory but monitor the plastic coating at the platform edge, further deterioration could result in snagging or corrosion hazards, no remedial action possible with this type of coating.					
4 Way Spring Mobile on Safety Grass	Miracle	VL	Generally satisfactory but monitor the paint condition at the centre plate					
Climbing Frame on Safety Grass	Miracle		Satisfactory condition					
Windsor Picnic Table on Grass	Wicksteed	M	Generally satisfactory but recommend timber slats are rubbed down and treated to maintain weather protection, monitor damage at centre slat and recommend excess bolt threads at one seat slat are trimmed to reduce potential snagging hazards ( <i>non-manufacturer's fixings</i> )					
		M	Generally satisfactory but monitor ground fixing & foundation integrity and recommend ground / turf levels are built up around the base fixing plates to reduce potential trip hazards					
3 x Timber Bench (2 outside area) on Grass	Unknown	L	Generally satisfactory but monitor the timber condition & foundation integrity, no wood rot evident but could be present below surface level					
Litter Bin Post Mounted	Unknown		Satisfactory condition					
Fence	Unknown	L	Generally satisfactory but monitor the timber condition & foundation integrity at the posts, wood rot evident in cross rails and could be present in posts below surface level					
		L	Recommend damaged slats are replaced					
Vehicle Access Gate	Unknown	M	Satisfactory condition but recommend this remains locked when not in use					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY : - <b>C. Newell</b> DATE : - <b>23.3.2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) ESTIMATE TO FIT PARTS * Based on all works ordered	<b>£0.00</b> <b>£165.00</b> <b>£165.00</b> <b>See sheet 4</b>	


Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	331730	Croft Way Recreation Ground Weedon Bec (rear of Village Hall) Northamptonshire, NN7 4QW			4 of 4
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Single Gate (bottom of field)	Unknown	L	Generally satisfactory but recommend the damaged securing hook is removed or replaced					
Single Gate (top of field)	Unknown	M	The hinge mounting slat is damaged and partially detached from the fence post, in addition, the self closing device and securing hook are damaged and wood rot is evident within the frame, recommend this gate is replaced as soon as possible					
		M	Recommend turf surface is reinstated at the entrance points to reduce potential slip and trip hazards					
Dog Litter Bin (outside area) Post Mounted			Satisfactory condition					
General		M	Monitor concrete approach footpath from Croft Way, further deterioration may result in trip hazards, recommend footpath repair or upgrade as soon as resources permit					
			The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)					
		M	The facility is located within an enclosed area but fencing and gates would not physically prohibit access by animals, recommend routine inspections include monitoring for and removal of animal faeces. <i>(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)</i>					
 Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- <b>C. Newell</b> DATE :- <b>23.3.2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR COST TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	£0.00 £165.00 £165.00 £80.00 £245.00		

A wide range of signs are available, visit [www.wicksteed.co.uk](http://www.wicksteed.co.uk) or contact [sales@wicksteed.co.uk](mailto:sales@wicksteed.co.uk) for more information



Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	331730	Cavalry Fields Play Area Fusilier Drive, Weedon, NN7 4TH			1 of 2
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2.25m 1 Bay 2 Seat Swing 1 x Flat & 1 x Cradle Seat on Tiles	SMP	L	Generally satisfactory but monitor paint condition at the top bar and cradle seat frames					
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.					
		L	Recommend soil and seed are added at the surface edging to reduce potential trip hazards					
2.4m Toddler's Slide on Tiles	SMP	M	Generally satisfactory but step design would prevent use by younger children without assistance, in addition, recommend step panels are cleaned to remove algal residue and reduce potential slip hazards					
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.					
Hippo Spring Mobile on Tiles	SMP		Generally satisfactory but fails BS EN 1176 design criteria at the following areas:-					
		L	Fails hand grip & foot rest requirements for spring mobiles (ref BS EN 1176- 6: 2008 clauses 4.6 & 4.7), no action recommended at present.					
		VL	Seat fixing insert caps have been removed					
		L	Monitor the gaps at tile joints where excessive gaps or lifting tiles could create trip hazards.					
Park Bench on Grass	Record	L	Satisfactory condition but located close to fence & could encourage climbing					
		L	Monitor the paint condition					
Litter Bin on Grass	Unknown		Satisfactory condition.					
Single Gate		MH	Generally satisfactory but the self closing spring is damaged and would not exclude animals or prevent toddlers leaving the play area and walking into the adjacent road, recommend spring is replaced as soon as possible					
		MH	Recommend turf surface is reinstated within the entrance to reduce potential trip hazards at the raised kerb edging					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>23.3.2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR COST TO FIT PARTS * Based on all works ordered	<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>£0.00</b>	



Certified Inspection Report for:			CONTACT :-	ORDER NO :-	SITE ADDRESS :-			SHEET
Weedon Bec Parish Council 16 St Mary's Way, Weedon Bec Northamptonshire, NN7 4QL			Sue Halkett Tel: 01327 341 057 E-mail: weedonbecpc@btinternet.com	331730	Cavalry Fields Play Area Fusilier Drive, Weedon, NN7 4TH			2 of 2
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Fence  Dog Litter Bin ( <i>outside area</i> ) Post Mounted  General		L	Generally satisfactory but fails Head & Neck probe test (ref BS EN 1176-1:2008, clause 4.2.7.2) between the railings and could result in entrapment hazard, no remedial action possible with fence design  Satisfactory condition.  The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			<i>A wide range of signs are available, visit <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a> or contact <a href="mailto:sales@wicksteed.co.uk">sales@wicksteed.co.uk</a> for more information</i>		
		M	The facility is located within an enclosed area but the damaged gate would not physically prohibit access by animals, recommend routine inspections include monitoring for and removal of animal faeces. (Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free of animal faeces)					
 <b>Wicksteed Leisure Ltd</b> Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>			<b>INDICATION OF RISK RATING ASSESSMENT</b> H/MH HIGH & MEDIUM HIGH RISK - See Introductory Notes M MEDIUM RISK - See Introductory Notes VL/L VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>C. Newell</b> DATE :- <b>23.3.2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR COST TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT	<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>£0.00</b>	

